PARTICULATE POLLUTION IN SOME FIBRE FACTORIES IN KANPUR

A Thesis Submitted
In Partial Fulfilment of the Requirements
for the Degree of
MASTER OF TECHNOLOGY

By V. A. SUDHAKARAN

to the

DEPARTMENT OF CIVIL ENGINEERING

IN DIAN INSTITUTE OF TECHNOLOGY KANPUR
JULY 1975

..... to Valsala,

Saya and Sniya.

11" F 76

CE-1975-M SID 1'AF

0. 1070

B 1976

CERTIFICATE

Certified that the work presented in this Thesis entitled 'Particulate Pollution in Some Fibre Factories in Kanpur' by Shri V.A. Sudhakaran has been carried out under my supervision and it has not been submitted elsewhere for a degree.

July, 1975.

Dr. G.D. Agrawal
Professor

Department of Civil Engineering, Indian Institute of Technology, Kanpur.

POST GRADUATE OFFICE
This thesis has been approved for the award of the Prigree of Masier of Pechnology (al Tech.)
In accordance with the regulations of the Indian lastitute of Pechnology appur Dated 15 7.70

ACKNOWLEDGEMENT

The author is very much indebted to Dr. G.D. Agrawal for his excellent guidance in the initiation, progress and completion of this work.

The author wishes to express his sincere thanks to Dr. A.V.S. Prabhakara Rao, Dr. Malay Chaudhuri, Dr. S.D. Bokil and Mr. C. Venkobachar for their encouragements during the course of this work.

The author is very grateful to Mr. N.V. Krishnan,
Asst. Director, Regional Labour Institute Kanpur, for his
help in getting permission to carry out the work in factories.

The author also expresses his thanks to Mr. Alamkhan of RLI, Kanpur; Mr. B.N. Vyas of J.K. Jute Mills; Mr. P.S. Saxena of J.K. Cotton Mills and Mr. S.C. Bhatnagar of Lalimli for their help in carrying out the field work.

The author is also grateful to the Govt. of Kerala for deputing him for higher studies under QIP.

TABLE OF CONTENTS

LIST	OF	$T\Lambda$	BLI	ES		viiı
LIST	OF	ΡΊ	GUF	RES		x
SYNOI	PSIS	3				xıiı
CHAPI	ER	l	•	INTR	ODUCTION	1
				1.1	History	l
					Progrest of Industrial Hygiene in Forei ,n Countries	2
				1.3	Conditions in India	3
				1.4	Pollution Conditions in Fibre Industries	4
				1.5	Effect of Particulate Pollution on Workers	1-
				1.6	Fibre Industry in India	5
				1.7	Need for Present Study	7
CHAP	TER	2	•	LITE	RATURE REVIEW	8
				2.1	Particulates and Their Effect on Health	8
				2.2	Fate of Dust Entering the Respiratory System	10
				2.3	Pnew oconiosis	11
				2.4	Other Hazards of Dust	12
				2.5	Control of Health Hazards due to Dust	13
				2.6	Engineering Control of Particulate Pollution	14

CHAPTER 3:	PROCESS DETAILS AND GENERAL POLLUTIO- NAL SITUATIONS IN FIBRE INDUSTRY IN	
	KANPUR	17
	3.1 Process Details	17
	3.2 General Pollution Conditions	22
CHAPTER 4:	OBJECTIVES AND PLAT FOR DETAILED STUDY	26
	4.1 Objectives	26
	4.2 Plan for Detailed Study	26
CHAPTER 5:	MATERIALS AND METHODS	31
	PART A FIELD MEASUREMENTS	31
	5.1 Details of Jute Mills	31
	5.2 Measurement of Particulate Concentrations	31
	5.3 Measurement of Velocity Distribution	35
	5.4 Measurement of Temperature and Relative Humidity	37
	5.5 Sampling for Microorganisms in Factory Room Air	38
	PART B LABORATORY WORKS	39
	5.6 Detcrunation of Weight Concentration of Particulates	3 9
	5.7 Determination of Particle Size Distribution	40
	5.8 Characterization of Particulates	43
	PART C THEORITICAL STUDIES	45
	5.9 Particulate Transport	45

	5.10 Velocity Distribution at Inlets and Outlets	50
	5.11 Air Flow Under Natural Ventilation Condition	55
	5.12 Concentration Transport	57
CHAPTER 6:	RESULTS AND DISCUSSIONS	59
	PART A PARTICULATE POLLUTION AND HAZARDS	59
	6.1 Pollution Hazards in the Jute Mills	59
	6.2 Pollution Conditions in a Cotton Mill	80
	6.3 Pollution Conditions in a Woollen Mill	80
	6.4 Comparison of Pollutional Hazards in the Three Fibre Factories	87
	PART B VENTILATION AND POLLUTANT TRANSPORT	90
	6.5 Existing Ventilation Conditions in the Jute Mills	90
	6.6 Velocity Distribution Inside Factory Room	95
	6.7 Temperature and Humidity Changes in the Factory Room	99
	6.8 Particulate Production	104
	6.9 Particulate Transport	106
	6.10 Inferences from Analysis of Settled Particulates	118
	6.11 Limitations of the Present Study	

		vii
CHAPTER 7:	PROPOSAL FOR AN IMPROVED VENTILATION SYSTEM FOR A TYPICAL FIBRE FACTORY	128
	7.1 Existing Ventilation System in the Jute Mills	128
	7.2 Modified Ventilation System in the Jute Mills	138
	7.3 Ventilation Considerations in the Planning and Design of a New Jute Mill	141
CHAPTER 8:	CONCLUSIONS AND SUGGESTIONS	144
	8.1 Conclusions	144
	8.2 Engineering and Hygienic Importance of the Present Study	145
	8.3 Suggestions for Further Studies	146
REFERENCES		148
APPENDIX - I	DESIGNS	152

LIST OF TABLES

T. SJ	pre No.		Page
	5.1	Structural and other details of the production hall in the jute mills where ventilation studies were carried out	34
	5.2	Relation of screen mesh to particle size	43
	6.1	Expected particulate concentrations at breathing height (150 cm above floor level) at worker positions in various sections of a jute null	64
	6.2	Hygienic significance of particulates in jute mill room air	71
	6.3	Free silica content of the total particulate in factory room air	∍s 73
	6.4	Viable nicroorganisms in factory room air	75
	6.5	Effect of particulate pollution on workers in the jute mills	7 8
	6.6	Relation of age of workers to effect of pollution.	7 9
	6.7	Relation of years of service to effect of pollution.	79
	6.8	Concentrations, particle size distributions, and hygienic significance of particulates in a cotton .ill.	81
	6.9	Details of particulates in various sections of a woollen mill	84
	6.10	Temperature and humidity changes in the factory room	lol
	6.11	Particulate production and transport	105
	6.12	Percent weights of particulate fractions at different heights in various sections of the jute mills	112

Γε	able No.		Page
	6.13	Comparison of size distributions of particulates in areas with and without exhaust fans	114
	6.14	Details of analysis of settled particulates collected from 2m height above softener section floor (Jute mills)	123
	6.15	Details of analysis of settled particulates at various heights in the carding section (Jute Mills)	126
	7.1	Operation schecule for existing ventilation system in the Jute mill	¹ 130
	7.2	Induced velocities below exhaust fans in carding section (Jute mill)	134
	7.3	Operation schedule for modified ventila- tion system in the jute mills	140
	7.4	Operation schedule for new ventilation system in a jute mill	143

LIST OF FIGURES

Fig.	• cM		Page
2.1		Relationship between prevalence of byssi- nosis and dust concentrations in work rooms	14
3.1		Processes in its mill	18
3.2		Processos in a sotton mill	20
3.3		Processes in a moollen mill	23
5.1		Locations of mills	32
5.2		General lay-out of factory room (jute mills)	33
5.3		Terminal velocities of spherical particles	48
5.1		Distance reached and velocity of spherical particles projected with velocity of 1000 fpm.	51
6,1		Seasonal variations in particulate concentrations (jute mill)	60
6.2		Variation of perticulate concentration with height (jute will)	65
6.3		Concentration pradicats along height (Jute mills)	66
6.4		Particle siz istribution - Dust fraction (Jute mill)	69
6.5		Particle siz. distribution - Fibre fraction (Jute mill)	70
6.6		Particle size distribution - Dust fraction (Cotton mill)	82
6.7		Particle size distribution - Fibre fraction (Cotton mil!)	83
6.8		Particle size distribution - Dust fraction (Woollen mill)	85

Fig. No.		Page
6.9	Particle size distribution - Fibre fraction (Woollen will)	86
6.10	Particulate pollution in various fibre factories and its effect on workers	88
6.11	Meteorological Jota - Average values (1971-75)	92
6.12	Relation between Air changes and particulate concentrations (Jute mills)	93
6.13	Velocity distribution - January (Jute Mills)	96
6.14	Velocity distribution - February (Jute mill)	97
6.15	Velocity distribution - April (Jute mill)	98
6.16	Velocity distribution at inlets	100
6.17	Relation of particulate concentrations to temperature and relative humidity	103
6.18	Particle size distribution - softener section (Jute mill)	107
6,19	Particle size distribution - carding section (Jute mill)	108
6.20	Particle size distribution - drawing section (Jute mill)	109
6.21	Particle size Clatribution - spinning section (Jute ill)	110
6.22	Particle size distribution - weaving section (Jute Hill)	111
6.23	Particle size Aistribution - carding section (Jute mill) - Area with exhaust fan	115
6.24	Effect of openings on horizontal transport of particles	116

Fig. No.		Page
6.25	Verticle transport of particulates - softener section (Jute mills)	119
6.26	Cumulative percent plot of fractions of settled particulates - softener section (Jute mills)	120
6.27	Size distribution of dust and fibre fract- ions of settled particulate-softener section (Jute mills)	122
6.28	Cumulative percent plot of fractions of settled particulates — carding section (Jute mills)	124
6.29	Size distribution of dust and fibre fract- ions of settled particulates - carding section (June mills)	125
7.1	Existing ventilation conditions (Jute mills) 129
7.2	Local exhaust over softener machine (Jute mills)	132
7.3	Exhaust system for carding section (Jute mills)	133
7.1	Modified ventilation system for the jute mill	139
7.5	Desirable ventilation system for a new jute mill	142

Particulate Pollution in some Fibre Factories in Kanpur

A Thesis Submitted in portial fultilment of the requirements for the degree of

Moster of Technology

by

V.A. Sudhakaran

to

The Department of Civil Engineering Indian Institute of Technology Kanpur.

SYNOPSIS

This thesis presents the details of studies carried out in three fibre factures - one each of a jute, cotton and woollen mills - in Anpur for ascertaining the particulate pollution conditions in their working environments, in general. It also gives results of detailed studies carried out in the jute mill to determine the health effect of particulate pollution on workers and to evaluate the adequacy of existing ventilation system in reducing the pollution. The results indicates that the pollution levels in the preparing sections of all fibre factories are higher than permissible limit, during all seasons of the year. A small percent of workers in the preparing sections of the

jute mill seems to show symptoms of Byssinosis. The results also indicates that existing ventilation is inadequate and natural ventilation alone cannot be depended upon for reducing particulate pollution. Modifications are suggested for improving the existing ventilation system. An outline of design considerations for a ventilation system for new jute mills is also given.

CHAPTER I

INTRODUCTION

Man, today, is fully aware of the adversities of pollution around him. Industrial workers are often exposed to a much more severcly polluted environment on the shop floo than would ever be experienced by the community in general. The capability of man to adapt to adverse conditions is well known. But the pollution conditions present in many industries are so severe that his tolerance limits are always exceeded and hence the problem. Today's factory worker is becoming more and more aware of these facts and is domanding a healthier and more comfortable environment to work in. A group of contented workers is an asset for any industry and for the country as industries are the buildings blocks of a ration's economy. Industrial hygienists have a great task of identifying the vast multitude/pollution problems and finding methods for their solution.

1.1 HISTORY

Awareness of man towards occupational diseases dates back to the times of Hippocrates who lived in the fourth century B.C. and was the first to record the adverse effects

of lead exposure upon miners and metallurgists. But the problem was not severe till the advent of Industrial Revolution. In the initial stages of the revolution, health and comfort of workers were not matters of concern for industrialists. By the beginning of the 19th century, labour legislations came into force (Patty 1958) and this paved the way for developments in the field of industrial hygiene. From then onwards, the progress made in this field is very encouraging. Today, industrial hygienists are capable of anticipating and preventing most hazardous situations before serious injuries are resulted.

1.2 PROGRESS OF INDUSTRIAL HYGIENE IN FOREIGN COUNTRIES

Industrially developed countries like the U.S.A.,

England, Russia, Germany and Japan have made extensive str
ides in the field of Industrial hygiene. Inws have been pro
nulgated requiring industries to remove dust and injurious
gases from the working area and to give compensation to

workers for accidents and infirmity resultedfrom working in

dangerous trades. In the U.S.A. many voluntary and social

organizations have also done good service in collecting

data and suggesting control measures. Some Educational

Institutions have started giving specialized instructions

in this field from 1940 onwards. In England medical phases

of industrial hygiene have received more attention than technical and engineering phases of evaluation and control. In Russia special attention is given to questions involving better labour conditions. In Germany numerous regulations are aimed toward medical examination and mechanical safeguards. The regulations are enforced by a host of factory inspectors. Japan has established an Industrial Hygiene association. There is ample evidence of growing interest in industrial hygiene in nearly all countries.

1.3 CONDITIONS IN IND /

The hygienic conditions in Indianindustries are very poor and little is done in improving them compared to the big advancements made by developed countries in this field. Many reasons may be attributed for this unfortunate situation and some are given below:

- 1) lack of information regarding pollution conditions in various industries,
- 2) the enormous cost of control measures,
- justified reluctance on the part of industrialists to invest huge amounts on control measures which give no return in terms of money.
- 4) unawareness of the workers of the potential dangers of pollution,

- black of effective legislation for implementing control measures (The penalties for not abiding the law are generally and industrialists may be happy in paying the penalty rather than investing on costly control measures); and
- tions. (At prescrit pollution conditions inside factori are assessed on the basis of reports from factory inspectors who seldom do their job sincerely).

1.4 POLLUTION CONDITIONS IN FIBRE INDUSTRIES

Fibre factories, mainly, have particulate pollution problems. During the preparing and finishing processes of natural fibres many particulates like dust, fibre and fumes will be escaping into the working environment of the factorie The nature and concentration of these particulates will depend on the type and grade of the raw materials, type of processing, effectiveness of control measures provided, if any, and the general ventilation conditions in the factory rooms. Exposure of workers to the pollutants is likely to be injurious to their health.

1.5 EFFECT OF PARTICULATE POLLUTION ON WORKERS

Particulate pollution in fibre factories have the following direct and indirect effects on the workers.

1.5.1 Direct effects:

Particulates of sizes less than 10 microns will go anto the lungs of workers during respiration. A large portion of the fine particulates will be deposited in the lungs caucing pulmonary dust diseases like silicosis, fibrosis, byssinosis, etc.

1.5.2 <u>Indirect effect:</u>

Indirectly particulates act as carriers of pathogenic organisms and toxic and irritant gases. Thus common cold, influnta, tubaculosis, etc, can be communicated through dust carrying these causative agents. Toxic gases which would have been removed in the upper parts of the respiratory tract are carried deeper into the respiratory system by dusts which carb and retain the gase:

I.O FIBRE INDUSTRY IN LOTA

In India, we have all types of fibre factories, 30 ntletic and natural. Particulate pollution in synthetic fibre factories are relatively much less compared to that in natural fibre factories due to the well controlled atmosphere needed and maintained even if for entirely different reasons.

Cotton industry is the largest single industry in India. In 1972, cotton textile industry consisted of 674 mills

with a total installed capacity of 182 lakh spindles and 2.08 lakh looms. The number of workers employed in these mills stood at 9.57 lakhs (Publications Division 1974). The major areas of cotton industry are Ahmedabad and Bombay. Kanpur is the largest centre of cotton textiles industry in Northern India and has 14 cotton mills.

As the biggest foreign exchange earner, jute industry occupies an important position in the country's economy. The export earnings from jute materials was Rs.263.29 crores in 1971-72. (Publications Division 1974). The jute industry employs 240,000 persons - 9 percent of factory labour in India (Kothari and Sons 1972). There are 64 jute mills in India of which 54 are located in West Bengal (Sham Ial ed. 1972). The amount of jute processed comes around 70 lakh bales per year. Kanpur also has a few jute mills.

There are 102 woollen mills in India and majority of them (40) are situated in Punjab. One of the largest, the 'Lal Imli' is however located in Kanpur.

The particulate pollution conditions in most of these factories are severe as there are but few control measures to reduce pollution. From the data given above it is clear that a large number of workers are exposed to the adverse effects of particulate pollution in fibre industries. The

resulting loss to the nation in terms of medical expenses and man-hours is bound to be quite significant.

1.7 NEED FOR PRESENT STUDY

The present stule was undertaken with the specific purpose of ascertainin, the particulate pollution conditions in some fibre factorie of Kanpur and its effect on workers. Attempt was also made to determine the influence of ventilate on particulate concentrations and transport inside the factory rooms. It is expected that the lesults of the study may serve as a basis for the design of improved ventilation systems for fibre factories with a view of reducing particulate pollution hazards to the health of workers.

CHAPTER II

LITERATURE REVIEW

Occupational diseases and their causes were topics of intense study during the last many decades. Health conditions of workers in cotton mills were quite deplorable till people recognised the actual causes. Investigations by Prausnitz (1932) showed that the inflamatory irritation of masal pharynx and bronchi among workers of cotton industry was caused by the high dust concentrations. Other investigations like Roach and Schilling (1960), Mokky et al (1967) and ropa et al (1969) have studied the health conditions of work
Jis in textile mills and found that their respiratory functions were adversely affected by the dust inhaled by them. The influence of inhaled dust on respiratory diseases was so pronounced that terms like 'pulcinary dust disease', 'pneumoconiosis' (a lung containing dust), etc have been added to the medical terminology.

2,1 PARTICULATES AND THEIR EFFECT ON HEALTH

Particulate is a term used to represent a large number of contaminants. According to Patty (1958), particulate matter includes aerosol, dust, fog, fume, mist, smog and sincke. In the present study the term particulate is used

of dust.

The entry of dust into the respiratory system and its possible retention there depends on the particle size . LaBelle (1955) records, that only 20 percent of particles of 5 size will penetrate the masopharynx where as there will be 100%penetration by 1 μ size particles. Brown et al (1960) explain the differential settling of dust particles at various levels of the respiratory tract. The particle size is also important from the point of view of particulate transport in the working environment. According to Hemeon (1963) fine particles of size less than 20 μ will move with the room air. So the escape of such particles into the air from various industrial operations will find its way into the respiratory system.

Surface area of dust is important as the same decides the amount of toxic gases sorbed by the dust. Synergic effect of aerosols causing changes in toxicity to vodents is reported by LaBelle (1955). Inert dust may become additionally harmful when some toxic gases also are present in the atmosphere. Fine particles will have a very large surface area. If a cube of a mineral l.ch. side were ground to form cubes of l μ size, it will result in 10^{12} particles with a total surface area of 6 sq. meters as compared with 6 sq.ch. for the original cube.

The settling rate of particulates are important in designing control measures for dust pollution. Chemical nature of the dust/decease which the particulate will cause. For example the presence of free silica in the environment in sufficient concentrations will lead to silicosis.

2.2 FATE OF DUST ENTERING THE RESPIRATORY SYSTEM

The human respiratory system is meant for supplying oxygen into the blood stream and removing carbon dioxide from it, the exchange sites being thin walls of alveoli situated deep in the lungs. Dust entering the lung with the air is a foreign matter and will do harm to the normal functioning of lungs.

During inspiration air enters the nasal openings, passes through the pharynx, larynx, trachea, bronchi and bronchioles, into the air sac or alveola (Hamlan 1944). Particles of size more than 15 to 25 microns will be caught in the nasal passage or at the back of the throat. Particles in size range of 5 - 15 microns impinge and get deposited on the moist walls of the respiratory passage (Altshuler 1957) In the alveola, the air is moving very slowly and finer particles settle and come in contact with the moist alveolar wall.

/ will decide the type of pulmonary dust

Particles caught before reaching the alveoli are continually swept toward the mouth by the celiated epithelium. Particles caught in the alveoli may be absorbed though the alveolar wall or may be engulfed in phagocyte cells and be carried into the blood capillaries, tracheobronehal lymph modes. It is here that fibrosis of healthy lining tissued starts following quartz-dust inhalation. Excessive inhalation of dust causes serious pulmonary disease generally named Pneumo-coniosis. Silicosis, asbestosis, anthracosis and byssinosis are few forms of pneumo coniosis, the names being derived from the type of dust deposited.

2.3 PNEUMOCONIOSIS

2.3.1 Byssinosis

This is a chronic respiratory disease of cotton, flax and hemp workers, characterised by chest tightness and breathlessness at work fter the weakend break or other absence (Schilling 1971). Epidemiological studies revealed that more than 40 percent of workers may be affected with less dust control. Recent evidence confirm that the disease in caused by some brancho-constricting agent contained in the leaves of cotton plant, but not in the fibres or seeds (International Labour Organisation 1971).

∠ or enter the lymphatics and be concentrated at the

2.3.2 Silicosis:

This is caused by inhalation of air containing free silica (Drinker and Hatch 1954). Workers in mines or rock crushing units, where SiO₂ content may be high in the air, are more susceptible for this disease. But in fibre factories also room air may a stain silica released from the raw material. This may be noted probable in woollen mill as raw wool will contains a good amount of silica. Cotton and jute also may contain silica depending on where they grow and how clean the raw materials reaching the factory are.

2.3.3 Fibrosis:

The pathologic changes caused by fibrous particulates are not like silicosis. The fibres group about the neck of an alveolus and stimulate the formation of a diffuse fibrosis (Drinker and Hatch 1954). As fibrosis increases, the reduction of lung area causes serious dyspnea.

2.4 OTHER HAZARDS OF DUST

Dust can be hazardous to can in an indirect manner too as carriers of pathe jonic organisms and toxic gases.

2.4.1 Dust as carriers of pathogenic organisms:

Microorganisms in the atmosphere are usually attached to aerosols. Caminita et al (1943) have found Gran-

negative nicroorganisms occurring in large numbers in low-grade cotton. The organism was responsible for acute illness which closely resembled 'mill fever' reported among cotton mill operators.

2.4.2 Dust explosion:

According to the Report of Important Dust Explosion (1957) many industries including cotton mills are susceptible for dust explosions. The explosion takes place when the concentration of certain particulates exceeds the Lower Explosion Limit (LEL).

2.5 CONTROL OF HEALTH HAZARDS DUE TO DUST

2.5.1 <u>Preumoconiosis</u>

There are two ways of controlling occupational diseases. viz. medical control and Engineering Control (Sander 1958). In medical control the workers exposed to dangerous concentrations of dust will be given annual medical examination which includes X-ray of the chest. The patient may be advised to leave or change the job depending on his pathological condition.

In engineering control the basic cause in the pollution condition will be reduced to tolerable limits. This has some advantage over the medical control as 'prevention is, always, better than curve'.

There are two standards for fixing the tolerance levels for different pollutants. As per the hygienic standard only such concentrations of pollutants will be permitted which do not directly or indirectly exert harmful or unpleasant effects on man. According to the sanitary standard the tolerance level is fixed considering the economical attainability and local conditions.

For example the permissible level of dust concentrations in industries is fixed by the American Conference of Governmental Industrial Hygienists based on the epidemiological survey of 458 cotton mill workers in which dust concentrations were also measured. The results were plotted on a graph as shown in Fig. 2.1. At a concentration of 4 mg/m³ more than 50 percent of workers had symptoms of Byssinosis. But there is a point in the graph at 1 mg/m³ when the

percent incidence was negligible.

So this concentration was chosen as the permissible limit. (International Labour Organisation 1971).

2.6 ENGINEERING CONTROL OF PARTI-CULATE POLLUTION

There are different methods of engineering control for reducing particulate pollution. Enclosed

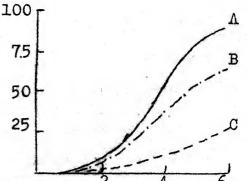


Fig. 2.1 Relationship betwee Prevalence of byssinosis and dust concentration. A, all grades, B, grades 1 and 2, C, grade 2.

processes, exhaust ventilation, process modifications, etc are a few engineering techniques used to ensure safe concentrations of dust in the air breathed by workmen (Sander 1958).

Personal protectives like respirators will afford individual protection under certain circuistances.

Enclosing the sources of potential dangers will prevent the dispersion of pollutants into the working environment thus protecting the worker. Exhaust ventilation removes contaminated air continuously so that their pollutant concentration never goes above permissible limits. Hewitt (1973) gives a method for the effective containment of air-borne contaminants by controlling the air flow pattern. This is a very useful method and will have wide applications in particulate pollution control. Works of Tuve (1944), Hama (1973), Dean (1974) etc give methods for the design of ventilation systems to reduce particulate pollution in industries.

Process modifications are methods like wetting to reduce the escape of particulates. (Bamford 1955) has determined the optimum moisture content which gives least dust raising in a foundary. Similar methods may be possible, in fibre industry also.

Particulate pollution control is well within the enpacity of engineers. The fine particulates of hygienic

significance can easily be removed or prevented from reaching the breathing zone of workers by controlling the air flow patterns and providing sufficient flow rates. The methods presently available are quite adequate for this purpose. In this connection it may be pointed out that ultrafine particles below 0.35 μ size, which are difficult to be removed from air streams, will not be deposited in the human lungs (Altshuler 1957). So an engineering control measure to eliminate all particulates of hygienic significance from the working environments of fibre factories will not be an 'utopian' dream but a practical feasibility.

CHAPTER III

PROCESS DETAILS AND GENERAL POLLUTIONAL SITUATIONS IN FIBRE INDUSTRY IN KANPUR


10

Fibre factories may be broadly classified into two catagories - natural and synthetic. For synthetic factories, complete or partial air conditioning is a process requirement. So particulate pollution - a problem facing most fibre factories - is nearly absent in these factories. In natural fibre factories we have cotton, jute and woollen mills. Kanpur has the fortune (or misfortune) of having units of each type.

3.1 PROCESS DETAILS

3.1.1 Jute Mills:


Fig. 3.1 shows the flow-diagram of various processes in a jute mill. The raw jute is sorted out depending on their quality. An emulsion (mixture of oil and water) is sprinkled on the jute to soften it. The jute then goes to the softening section where it is sent between toothed rollers. Emulsion is supplied here also. The bigger impurities from the jute are removed in this section. The jute is then piled for a period varying from 24 hours to 5 days depending on the quality of jute, softer varieties requiring shorter periods and harder ones longer periods. The jute then goes

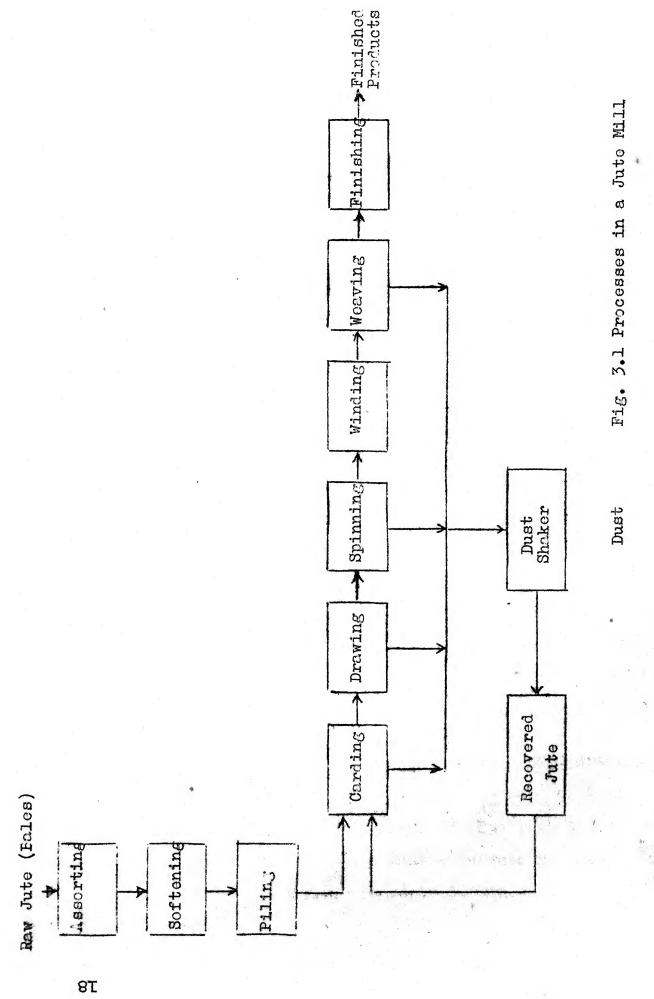

to the carding section. Before feeding to the carding machines the harder portions (usually the ends) will be removed by cutting. In the carding section jute passes through three types of carding machines - breaker cards, inter cards and finisher cards - in succession. The processes are designed to break up hard tufts and to remove impurities and short fibres. (The particulate pollution is maximum in these sections.) This is achieved by passing the jute between a scries of spiked cylindrical rollers. In the drawing section the sliver rolls (product of carding section) are passed through drawing frames for combing action to make the fibres parallel and to reduce the weight of fibres as per specifications. the spinning section threads are made by high speed spinning The threads are wound on rollers (beams) or cops to make 'warps' and 'wefts' respectively for weaving. products are marketed after finishing processes like damping calendering etc.

3.1.2 Cotton Mills

The different processes in a cotton mill are given in Fig. 3.2. The raw cotton codes in the form of bales. The bales are opened and raw cotton is fed into the bale breaking machine. The cotton passes between rollers when dust and other impurities are removed. Then it passes

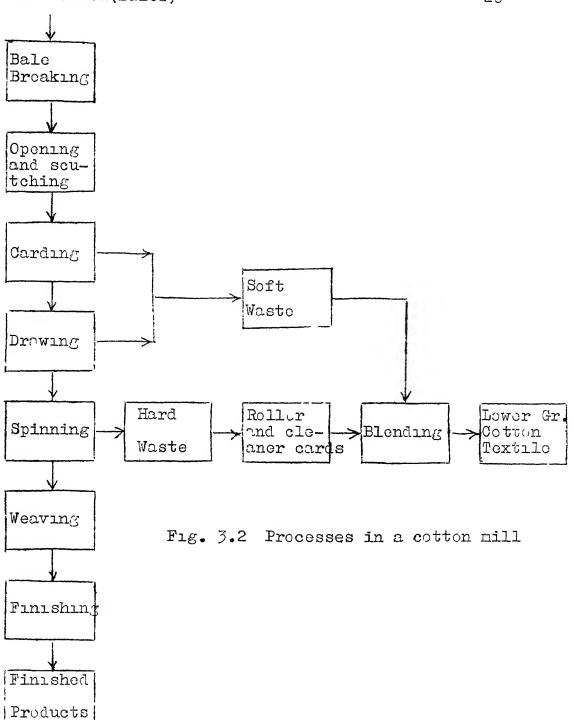

through a revolving beater where centrifugal action removes dust and impurities. Then it goes to opening and scutching machines where mixed cotton is further cleaned and opened by the combined action of revolsing beaters and air currents against a grid through which the dirt passes. The cotton energing out, in a much bulkier form, is rolled and sent to the carding machines. Carding is designed to make the eatton fibres parallel to each other, to break up hard tufts, and to remove short fibres and impurities. For this the cotton is sent through a sieve of toothed and spiked cylindrical rollers and finally bring the fibres together in a rope like form known as sliver.

The slivers then go : to the spinning section where drawing, slubbing and roving machines are used for elongating and attenuating the cotton yarn. The final step in this section is further attenuation of the yarn accompanied by simultaneous twisting. This is done by a machine called a ring frame. The yarn is now ready for weaving. The two sets of threads - warps and wefts - required for weaving are wound on long rollers and small tubes called cops respectively. The finishing operation that follows consists of a series of processes like singering, desizing, scouring, dyeing, etc.

3.1.3 Woollen Mills:

The major processes in a woollen mill are given in Fig. 3.3. The raw wool coming as bales are opened and fed to a scouring machine, where it is washed and cleaned using detergents and hot water. All dirt and grease from the wool are almost removed by this operation. The scoured wool goes to the blending section where wools of different qualities are mixed together. Fearnought, an important machine used for preparation of blends does the opening of wool preparatory to carding. Onling of wool also is done at this stage. The wool then goes to carding section where it is sent between toothed and spiked rollers. The combing action straighted the fibres and the wool comes as threads which goes to drawing and spinning sections. In these section the threads are clongated attenuated and twisted to make fine threads. Weaving, milling and finishing of the products follow.

3.2 GENERAL POLLUTION CONDITIONS IN FIBRE FACTORIES

3.2.1 Jute Mills:

Probably, this is the most polluted of the three types of mills, especially in the proparing sections. In the assorting, softener and carring sections the particulate pollution is visibly high compared other sections. Exhaust systems provided does not seem to function effectively. Noise levels

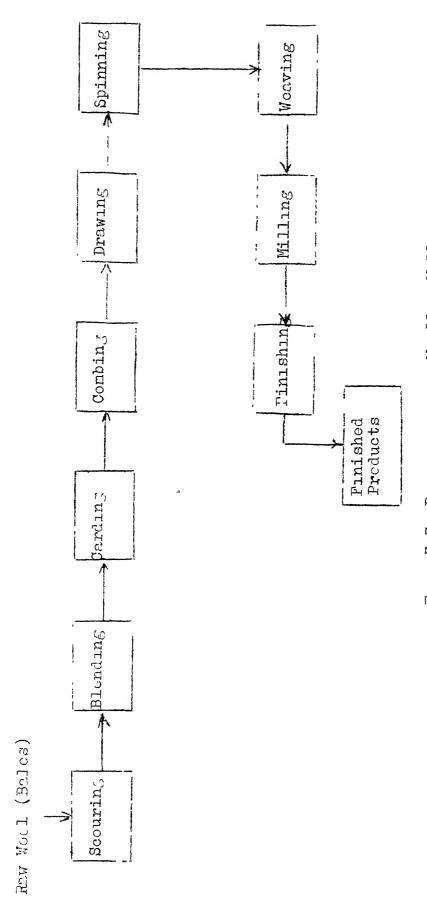


Fig. 3.3 Processes in a Woollen Mill

in the weaving section was found to be high. Most workers in the preparing sections are affected by the particulate pollution. A few workers in these sections were found to be using some cloth to cover their nostrils.

Humidifiers are used to maintain required humidity conditions. Temperature control is done only during summer when cool air is supplied into the room. But for the particulate pollution the conditions inside the factory seem to be generally, comfortable to workers. However, during hot seasons when cool air was not supplied the workers were exposed to temperature stresses. The disconfort may be caused by the high humidity. The contribution of the mill to air pollution was found to be insignificant.

3.2.2 Cotton Mills:

Pollution conditions were found to be existing in most sections of the cotton mill. The local exhaust arrangement in the preparing sections help to reduce particulate pollution to a great extend. The high relative humidity maintained in the spinning and weaving mills increases the worker disconfort. In the finishing sections like bleaching and dye houses the temperature was found to be very high. The particulates collected in the initial stages were simply released to the atmosphere. Its contribution to air pollution is more compared to that from the jute mills.

3.2.3 Woollen Mills:

Particulate pollution exists only in the scouring and old carding sections. Cool air is not supplied in any of the sections. So during summer months the heat stress on the workers is high. Contribution to air pollution is not through particulates escaping from the processes.

In general pollution condition in preparing sections of the factories are high. Workers in these sections have health problems create' by particulate pollution. It seems that control of pollution is not difficult.

CHAPTER IV

OBJECTIVES AND PLAN FOR DETAILED STUDY

.i.l OBJECTIVES

The objectives of the present study were :

- Assessment of particulate pollution and characterization of the particulate; present in the various sections of fibre factories.
- 2) Assessment of seasonal variations in pollution conditions and their relations to the then prevalent ventilation conditions.
- 3) Assessment of the effect of particulate pollution on the health and comfort of workers.
- 4) Evaluation of the adequacy of existing ventilation system to reduce particulate pollution in the working environments of factory rooms.
- 5) Finding the defects in and suggesting remedies for the present ventilation system. and
- 6) Suggesting a desirable ventilation system for fibre factories.

4.2 PLAN FOR DETAILED STUDY

The study involved three distinct aspects:

1) Field investigations - Measurements and sampling in fibre factories

- 2) Laboratory work
- Analysis of collected samples for quantitative determination of undesirable items.
- Theoritical studies Evaluation of the performance of the present ventilation system and design of a desirable ventilation system for fibre factories.

4.2.1 Field Investigations:

It was proposed to carry out studies in one unit each of the three types of intre factories, viz., jute, cotton and woollen. The jute factory where the problem of dust pollution inside the factory was apparently much more severe the either cotton or woollen mills was chosen for a relatively more detailed study while in case of the other two mills only skeleton studies could be made in view of the available time and effort.

Details regarding the location and orientation of the relected factories were collected. Meteorological data like wind speed and directial, temperature and relative humidity in the area were collected from the observatory at the Institute of Agricultural Science, Kanpur. For the jute mills, the dimensions of the various sections, locations and

sizes of openings, locations of machinery, etc., were found out and requisite plans and sections prepared. Details of exhausts - their number, locations, capacities, etc., were recorded.

The following measurements and sampling operations were carried out for the assessment of actual situations and for suggesting improvements.

- 1) Particulate Production and Transport: A detailed study of the various processes was made giving special importance to the mechanism of production and transport of particulates. Effort was made to determine the quantity of air-borne particulates produced by different machines. Estimates were also made of the amount of Particulates settled on the floor, the quantities discharged through doors and other openings and that carried away in the exhaust streams.
- 2) Particulate Concentrations: Concentrations of particulates in the room air were found out using standard sampling methods. For this, the room was devided into grids of convenient sizes and sampling carried out at grid points. The vertical dispersion of particulates was studied by measuring concentrations at different levels (50, 150 and 300 cm.) above floor level. These measurements were carried out during different seasons (in the case of the jute mills) to ascertain the seasonal variations in particulate concentrations.

सकल तारुएया का उराहरणा—

नेह मद छाई चितवन चतुराई त्यों,

कुमार सुकुमारताई मालती विसारिए।

गति गरवाई खुलि छाई है गुराई गात,
बातिन सरसताई सुधानिधि धारिए।।

प्यारी के निहार पानि पगनि दगनि लाली,
कोकनद कांति त्यों गुलाव वार डारिए।

श्रानन समान नाहीं होत याही दुख माँह,
सुख माँह छाँह छवि-नाह के निहारिए।।

वत्सल-रस का उदाहरणः-

वैन सुन्यो वन तें हरि श्राए बने नट-नेष की भाँति गद्दी है। मात जसीमित द्वारिह दौरि गई सुत देखन कों उमही है।। कान्हर को सुख चूमित चूमित जाइ हिए निधि मानी जहीं है। श्राँचर पोंछिति गोरज धूजि है फूज हिए सुख भूजि रही है।।

शांतरसानुभाव का उदाहरणः—

जनम गवायो वादि जित त् सवाद विष,
विषयन मदन विषाद हू श्रघाइगौं।
कइत 'कुमार' सनसार है श्रसार ताहि
मानि सुखसार श्रघ श्रोगुन हू श्राहगौ॥
चंचल वचंक मन रंचक न जानी कान्ह,
भवपारावार बीच नीच तू समाइगौ॥

- 1) the weight concentrations of particulates in the various departments of the factories.
- 2) the particle size distribution mean sizes by number and weight, standard deviation and percent fractions of different sizes, and
- 3) the characterization of the particulates separation of dust and fibre fractions, fixed and volatile fractions and determination of free silica and microorganisms.

4.2.3 Theoritical Studies:

The velocity distribution and flow patterns inside the factory room are important factors in controlling the particulate pollution. Actual measurement of velocities is very tedious and time consuming. Theoritical computations are possible to determine the velocity distribution inside the factory room for known inlet and outlet conditions. even this is difficult because of the complexities produced by the presence of machinery and other fittings, movement of workers and velocities induced by moving parts of machinery. Approximations could be done by treating the inlets and outlets independently and determining the velocity distributions around them and then combining the flow patterns to get an overall picture. In this case care should be taken to balance the inflow and outflow. This approach was followed to determine the adequacy of the present ventilation system and to design a more desirable one for the jute mills.

CHAPTER V

MATERIALS AND METHODS

PART A FIELD MEASUREMENTS

As stated earlier, the study was carried out in three factories ->no jute mill, one cotton mill and one woollen mill. The locations of the mills are shown in Fig. 5.1.


5.1 Details of Jute Mills:

The production line of the mill includes softener, carding, drawing, spinning, winding and weaving sections. In the jute mill where ventilation studies were carried out these sections are housed in one hall. The general lay-out of the sections with machinery, fittings, openings and exhausts is shown in Fig. 5.2. The structural details of the production hall are given in Table 5.1.

5.2 MEASUREMENT OF PARTICULATE CONCENTRATIONS

5.2.1 Equipment

The particulate concentrations in the various sections were measured using a M.S.A. Fixt-Flo-Air Sampler (American Conference of Governmental Industrial Hygienists, 1966), an instrument designed for collecting large samples of aerosol contaminants on filters for weighing and analysis in industrial hygiene and air pollution problems. M.S.A. Air Sampling Filters used along with this instrument are made

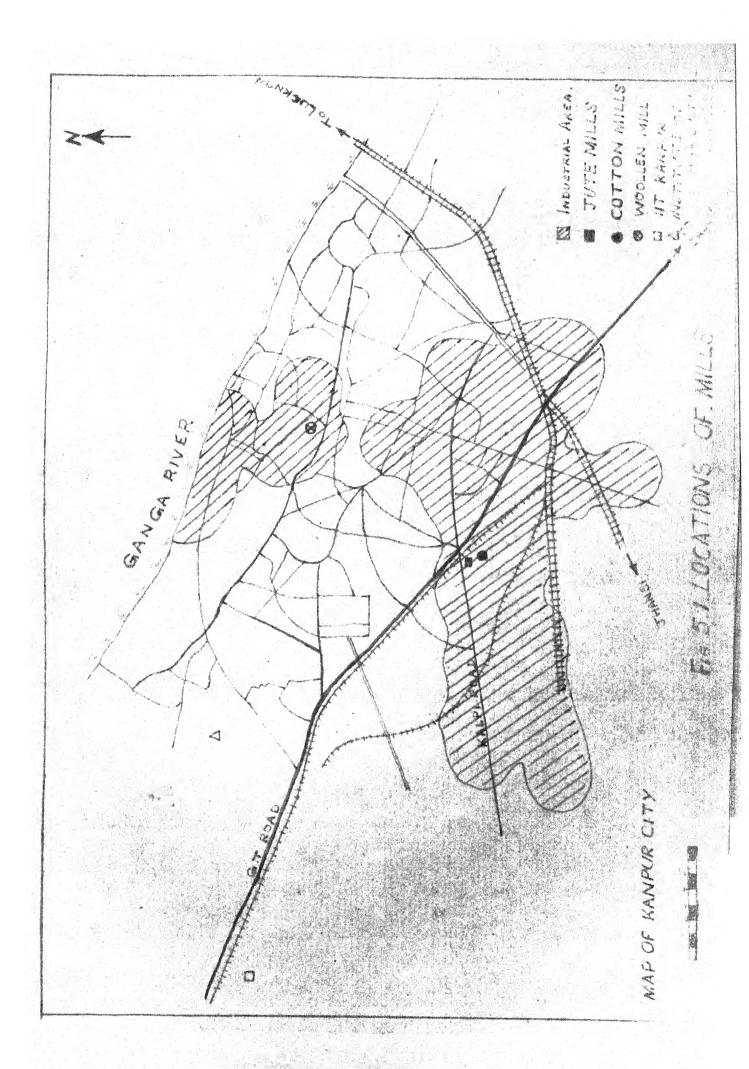

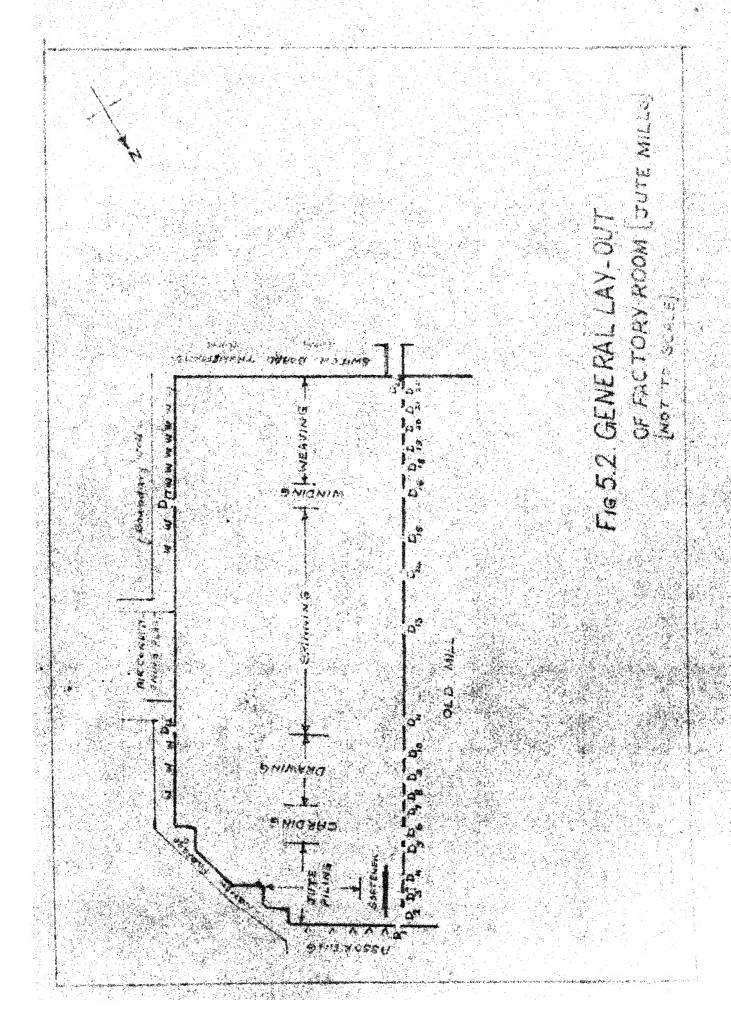


Table 5.1 Structural and Other Details of the Production hall in the Jute Mills where Ventilation Studies were carried out.

Particulars	Dimensions						
Production hall size	145 x 38 x 4.5 m (with some irregular shapes at one corne						
Production hall volume	21700 m ³ (net)						
Number of doors	23						
Number of windows	14						
Number of sunlight openings on roof	91						
-do- northern side	5						
Free area of doors on eastern side	9.06 m ²						
-do- on northern and southern sides	8,94 m ²						
-do- on western side	140.64 m ²						
Free area of windows (all on eastern side)	42.00 m ² ++						
Number of exhaust fans	4						
Maximum capacity of exhaust fans	59, 2 00 m ³ /hr.						
Number of air supply inlets	60						
Rate of air supply	298,000 - 430,000 m ³ /hr.						

⁺ as on 7 - 4 - 1975. Later modifications not included.

⁺⁺ The windows are ke t open or closed depending on season.

of cellulose, glass fibre or a combination of them.

5.2.2 Sampling Operation:

At the sampling site, a previously weighed filter paper was placed on the suction side of the sampler with its plane side facing the direction of airflow. The sampling was carried out for a particular period of time and the filter paper with sample on it was carefully removed, put in its cover and taken for analysis in the laboratory.

5.3 MEASUREMENT OF VELOCITY DISTRIBUTION

The velocity distribution in the room, at the openings and exhaust were determined by using an Amenotherm - Air Meter (American Conference of Governmental Industrial Hygienists, 1964) and a Vane-Amenometer.

5.3.1 <u>Instruments</u>

a) Anemotherm Air Meter: This is a unique example of hotwire anemometer used to measure velocities in the range of 10 - 8000 fpm. The probe of the instrument consists of two coils of fine nickel wire which connect through a cable to form arms of a Wheatstone bridge. One of these coils is heated by a separate current passing through a third coil of nichrome wire - in thermal contact but electrically insulated from it - forming a conductive junction. Air passing over the probe element cools the heated wire and varies its resistance. This is reflected as a variation in air velocity on the pointer type scale. The instrument can be used to measure temperatures ranging from 0 to 255°F by disconnecting the heater current when the unheated wire acts as a temperature sensitive resistance in the bridge circuit. It can also be used to measure static pressure in terms of inches of water from 0 to 10 in. water gauge, positive or negative by a combination of the probe and an auxiliary static pressure cap.

b) Swinging Vane Anchometer (Velometer): It is a portable instrument extensively used in field measurements. It consists of light vanes radiating from a common shaft and set to rotate when facing the wind. The vanes operate a counter which indicate the air speed in fpm. The minimum air velocity should be 200 fpm. for accuracy according to the maker's note of the velometer used.

5.3.2 Procedure:

The Anemotherm Air Meter was kept in operating condition by connecting the probe to the instrument main, selecting the proper range and making the necessary checks. The probe was then held in the direction of air flow and the pointer was read when it became stationary. The procedure was repeated to measure velocities at different elevations

and at different stations. At doors, windows, and exhaust openings where the velocity of flow was more than 200 fpm. velometer was used for the measurement.

5.4 MEASUREMENT OF TEMPERATURE AND RELATIVE HUMIDITY

5.4.1 <u>Instruments</u>

A sensitive mercury-in-glass thermometer with a range of 0 - 100°C was used for the measurement of temperature. A Sling-psychrometer, the simplest form of wet-and-dry-bulb psychrometer was used for determining relative humidity. This instrument has two mercury-in-glass thermometers mounted on a frame and arranged with a swivel-mounted handle at the end so that it can be swung rapidly to give proper air velocity. The wet bulb is covered with a cotton wick which was be wetted with clean water before use.

5.4.2 Procedure:

The wet bulb of the psychrometer was, first, moistened with clean water. The instrument was then swung by the handle for some time and the wet and dry bulb readings were noted. The swin,ing and reading were continued until two wet-bulb readings agreed. The relative humidity was, then, calculated using a psychrometric table.

5.5 SAMPLING FOR MICROORGANISMS IN FACTORY ROOM AIR

The microorganisms in the factory room air were trapped in a liquid by bubbling the air through it. Subsequent plating of the liquid and incubation, developed colonies which gave a measure of the number of organisms per unit volume in the room air.

5.5.1 Instruments

a) Midget Impinger: The M.S.A. Midget Impinger (American Conference of Governmental Industrial Hygienists 1966) is a portable hand operated instrument used for dust sampling. This can also be used for determination of air-borne micro-organisms and some gaseous contaminants. It consists of a glass flask partially filled with a liquid. A hand-cranked, four cylinder pump connected to the impinger draws air through it at a relatively high speed. The air strikes at the botton of the flask and the high velocity action causes the dust and other air-borne materials to be 'wetted' and retained in the liquid.

5.5.2 Procedure:

The outlet of the glass flask previously filled with dilution water and sterlized was connected to the hose of the pump with due care to avoid contimination. Air was drawn through the liquid for 5 min. at a vacuum of 10 in.

of water. (The flow rate for this pressure was determined using a wet meter and was found to be 3 liters/min.). After the sampling the openings were plugged with sterilized cotton and the sample was taken for plating. The sampling was carried out at other stations in the section and in all other sections.

PART B LABORATORY STUDIES

The samples collected from the fibre factories were analysed in the laboratory to determine the weight concentrations and size distributions of particulates. The fixed and volatile fractions and the amount of free silica in the particulates were found out. The number of microcorganisms per unit volume of room air was also determined.

5.6 Determination of Weight Concentrations of Particulates

The cover with the filter paper was placed in an oven at 110° C for 2 hours to evaporate off any moisture present, and then decicated and weighed. The particulate concentration at the station was given by:

Particulate concentration $(ng/n^3) = (Final weight (ng) -$

Initial weight(mg);/Vol. of air sampled (m³)

The sample deposited on the filter paper was carefully collected for further analysis.

5.7 DETERMINATION OF PARTICLE SIZE DISTRIBUTION

The particle size distributions of the samples were determined by microscopic analysis (Allen 1968).

5.7.1 Materials:

- a) Microscope: A light microscope with a maximum magnifying power of 2000 was used to measure the sizes of particulates. The resolving power was 0.2 micron. The microscope has an occular scale on which the sizes of particulates could be directly measured. The occular scale was calibrated using a stage micrometer.
- b) <u>Preparation of slides:</u> This is the most important part in the microscopic analysis as it decides the accuracy of the analysis. The materials required are:
- i) glass slides, cleaned, first, with detergent and clean water, then washed with distilled water and finally with absolute alcohol..
- ii) cover slips similarly treated,
- iii) camel-hair brush, and
- iv) glycerol dispersing medium.

Procedure: Few drops of glycerol were placed on a clean slide. A small quantity of the particulates from a representative sample was put in the glycerol and mixed well with a

camel-hair brush. More glycerol was added to get the required dilution. A drop of the mix was taken on the brush and put on another clean slide. A cover slip was carefully placed over the drop. The slide was then ready for examination under the microscope.

5.7.2 Microscopic examination

The prepared slide was placed on the specimen-stage of the microscope. The sizes of the particulates were measured using the occular scale at 3.5 x magnification. Frequency of particulates of same rize was determined by scanning the entire length of the slile. The process was repeated with other magnifications and frequencies of particulates of smaller and smaller sizes were determined. Care was taken to observe the same area of the slide while using all the magnifications.

5.7.3 Mean sizes and Standard Deviation:

The cumulative percent of the number of size fractions starting from the smallest were plotted against log sizes on a log-probability paper. A straight line was fitted through the points, giving more importance to the points near the 50 percent region. The particle size corresponding to 50 percent cumulative gives the geometric mean size by number. The standard deviation is given by the ratio of the

size corresponding to 84.13 percent and the mean size. The geometric mean size by weight was determined using the formula (Hatch, Choate 1929),

$$\log \overline{d_{wg}} = \log \overline{d_g} + 6.908 \log^2 s_g$$

where,

 $\overline{d_{wg}}$ = the geometric mean size by weight (μ)

 $\overline{d_g}$ = geometric mean size by number (μ), and

s = standard deviation, which will be the same for both distributions.

5.7.4 Percent Fractions by Weight:

The percent fractions by weight could be found out directly by separating the fractions from the sample by sieving, elutriation, hydrometric analysis or by use of instruments like cascade impactor. These operations require large sample. Also methods like elutriation allows flocculation of particulates and the fractions separated may not be true fractions of actual sample. It could also be determined indirectly by using plots of cumulative percent by number vs particle size.

late

In the case of settled particu/large quantities were available and sieving was the method followed for analysis.

U.S. standard sieves were used for this purpose. The relation between the screen mesh and particle size is given in Table 5.2.

Table 5.2 Relation of Screen Mesh to Particle Size

U.S. Standard Sieve Mesh	400	325	275	200	140	100	7 5	60	35	18
Nominal Sieve Opening in Microns	37	44	53	74	105	149	208	250	500	1000

For samples collected from room air the quantities were too little to go for any method other than an indirect microscopic method. In the plot of cumulative percent fractions by number vs particle size, the computed value of geometric mean size by weight was marked on the 50 percent line. A line parallel to number size distribution line was drawn through this point. This line can be taken to represent the size distribution of particulates by weight. The percentages of different size fractions were directly read from the plot.

5.8 CHARACTERIZATION OF PARTICULATES

5.8.1 Fixed and Volatile Fractions in the Particulates:

Known quantities of samples were kept in weighed nickel crucibles. The crucibles with samples were kept in a nuffle furnace at 600°C for 2 hrs. They were, then, removed from the furnace, decicated and weighed. The loss in weight is due to the burning of volatile fractions. The percentages of fixed and volatile fractions could then be calculated.

J.8.2 <u>Determination of Free Silica</u>:

The method described by Durkan (1946) was used for the determination of free silica in the particulates of the factory room air. The method includes HCl digestion, H₃PO₄ digestion and dilute HF treatment.

5.3.3 Microorganisms in the Particulates:

- a) Medium for Samplin: The medium for sampling was prepared as per specifications given in Standard Methods (American Public Health Association 1971). 1.25 ml of stock phosphate buffer solution was added to 1 liter of distilled water to make the dilution water. The stock phosphate buffer solution was made by dissolving 34.0 g of potassium dihydrogen phosphate (KH₂PO₄) in 500 ml distilled water. The pH was adjusted to 7.2 with 1N. NaOH and the solution was diluted to 1 liter with distilled water.
- b) Procedure: The samples collected from various sections of of the factory were plated and incubated and total plate count made as per specifications given in Standard Methods (American Public Health Association 1971).

Dilutions of samples were made by transferring 1 ml of the original sample to 99 ml of dilution water and then 1 ml of this diluted sample to 99 ml of dilution water. 1 ml of sample from the specimen and two dilutions were transferred to petri dishes. Three plates were made for each sample and for each dilution. They were then incubated at $35 \pm 2^{\circ}$ C for 24 ± 2 hrs. The counts were made using a bacterial colony counter.

PART C THEORITICAL STUDY

The experimental studies alone may not give a complete picture of the phenomena of particulate transport and room air movement. So a theoritical approach also was attempted.

5.9 PARTICULATE TRANSPORT

5.9.1 Settling Property of Particles:

When a discrete particle falls through a medium (air, in this case) under the influence of gravity it will be acted upon by two forces viz. the gravitational force and the resistance of the medium. Under the influence of these forces the particle accelerates for a short distance and then settles at a uniform terminal velocity when the resisting force equals the gravitational force. The gravitational force is a constant for a particular particle and

is given by

$$F_g = (P_p - P_a)gV.$$

where,

 $F_g = gravitational force,$

 ρ_{p} = mass density of the particle,

 $\rho_{\rm a}$ = mass density of the air medium,

g = gravity constant, and

V = volume of the particle.

The resistance of the medium is a function of the dynamic viscosity, μ , and mass density ρ_a of the air and the velocity v_s and characteristic diameter d_p of the particle. Dimensionally, the resisting force may be expressed as:

$$F_{R} = \varphi(v_{s}, d_{p}, F_{a}, \mu)$$

Introducing fundamental units and solving, we get

$$F_{R} = v_{s}^{2} d_{p}^{2} f_{a}^{p} \phi (v_{s} d_{p} f_{a}^{p} / \mu)$$
$$= v_{s}^{2} d_{p}^{2} f_{a}^{p} \phi (R_{e})$$

where $R_{\underline{e}}$ is the Reynolds number.

Substituting A, the cross sectional or projected area for d_p^2 , $\rho_a^2 v_s^2$, the dynamic pressure for $\rho_a v_s^2$, and c_D , Newton's drag coefficient for $\phi(R_e)$

$$F_{R} = \frac{c_{D}^{\Lambda} \rho_{a} v_{s}^{2}}{2}$$

The magnitude of C_{D} varies with R_{e} and for spherical particles may be approximated as (Camp 1946)

$$C_{D} = \frac{24}{R_{e}} + \frac{3}{R_{e}^{\frac{1}{2}}} + 0.34$$

Equating the gravitational force and resisting force, the terminal velocity is given by

$$\mathbf{v_s} = \left\{ (2g/C_D)[(\rho_p - \rho_a)/\rho_a](\nabla/\Lambda) \right\}^{\frac{1}{2}}$$

For spherical particles,

$$\mathbf{v}_{s} = \left[\left(\frac{4}{3} \, \text{g/c}_{D} \right) \left[\frac{\rho_{p} - \rho_{a}}{\rho_{a}} \right] \, d_{p} \right]^{\frac{1}{2}}$$


For high Reynolds number (R $_{\rm e}=10^3$ to 10^4 and C $_{\rm D}=0.4$) the flow is turbulent and

$$v_s = [3.3 \text{ g} (\frac{\rho_p - \rho_a}{\rho_a}) \text{ dp}]^{\frac{1}{2}} \text{ (Fair et al 1968)}$$

For laminar flow conditions at low Reynolds numbers ($\kappa_{\rm e}$ < 0.5, and $c_{\rm D}$ = 24/ $P_{\rm e}$), the terminal velocity is given as

$$v_s = \frac{g}{18 \mu} (\rho_p - f_a) d\rho^2$$

The terminal velocities of particulates under the laminar and turbulant flow conditions are given in Fig. 5.3.

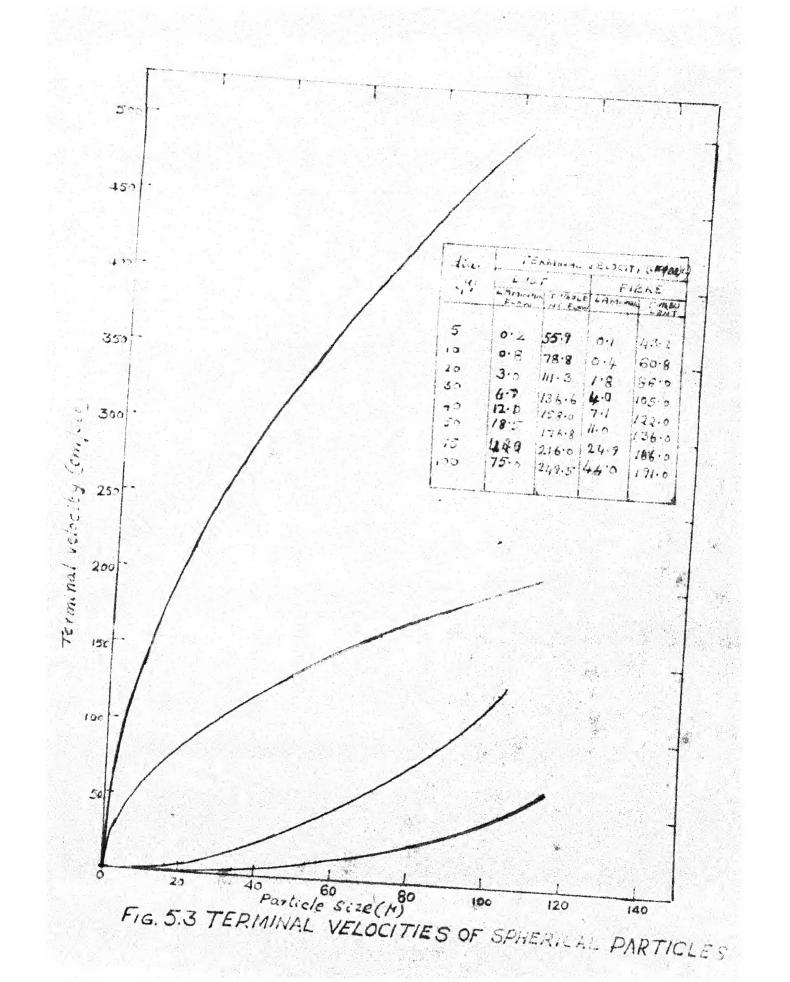

According to Ingersoll et al. (1956) the settled particles will be removed when the velocity of flow exceeds certain limits. The displacement velocity is given by;

$$v_{d} = (8/f)^{\frac{1}{2}} v_{s}$$

where,

 v_s is the settling velocity and f is the Weisbach-Darcy friction factor. For $f=2.5 \times 10^{-2}$, v_d should be below 10 v_s (Fair et al. 1968)., if the particles have not to be moved.

5.9.2 <u>Inertial Property of Particulates:</u>

A particle projected with a certain initial velocity will be acted upon by the frictional resistance of air and its speed will be reduced in accordance with the distance-velocity relationship (Hemeon 1963).

$$\delta s = \int_{u_0}^{u} \frac{u \, du}{s - \frac{C_D \rho_a \Lambda u}{2 W}} 2$$

where,

 δs is the distance travelled by the particle when the initial velocity u_0 is reduced to u_\bullet and W is the weight of the particle.

For turbulent flow where \mathbf{C}_{D} is 0.44, the integration of the equation will give,

$$\delta s = \frac{7f_p}{\rho} \cdot d_p \cdot \log_{10} \frac{u_o}{u}$$

Substituting for $\rho_{\mathbf{a}}$ and expressing $\mathbf{d}_{\mathbf{p}}$ in microns

$$\delta s = 93 \times 10^{-4} / p d_p \log_{10} \frac{u_o}{u}$$

The distance travelled by particles of 20 and 100 μ dia. with density 2.5 g/c.c. and that of 100 μ dia. with density 1.47 g/c.c. (Mantell 1958) are shown in Fig. 5.4.

5.10 VELOCITY DISTRIBUTIONS AT INLETS AND OUTLETS

In a mechanical ventilation system air is extracted from space through exhausts and compensating air is supplied through supply inlets. The pattern of air flow depends upon inlet and outlet positions, the rate of flow and the interior conditions. As far as the factory room being studied was concerned, the interior conditions are so complex that it is almost impossible to use a theoritical approach to determine accurately the complete flow pattern. Still, making the assumptions that the inlets and outlets function independently (which, never, is the case), the flow pattern for these may be combined to get an overall picture.

5.10.1 Velocity Distribution at Inlets:

Air into occupied spaces is usually supplied in the form of jets. To predict the velocity distribution in the jet-stream, the basic relations of the continuity equation, the equation of motion, and the conservation of total

Verocity (fim. +33 500 CO - "H 6:2.5 THE MENT OF YOUR PARTY AND VOICE !! 100 VELOCITY (FPM) E 00 4.7.1 500 800 0.21 3.044 DISTANCE (CM) 100% A. 2.5 0.133 0.33 85.120 0.548 100 /4 7

CENTRAL LIBRARY

momentum in the direction of flow are made use of.

Schlichting (1958) found a relation for the velocity at a radius r from the centre line of the jet at a distance of x from the face as

$$u = \frac{7.41 \sqrt{J/P}}{x[1+57.5(-\frac{r^2}{x^2})]}$$

where,

J = total momentum, and

P = density of air

Along the centreline the value of $\, {\bf r} \,$ is zero and u become $u_{\hbox{\scriptsize cl}},$ the centreline velocity at $\, x$.

$$u_{cl} = \frac{7.41\sqrt{J/\rho}}{x}$$

Substituting for $J=u_0^2 \Lambda_0$, where Λ_0 is the face area and u_0 is the face velocity of the jet,

$$u_{cl} = \frac{7.41 \text{ VA}_{o} \text{ u}_{o}}{\text{x}}$$

or, in general,

$$u_{cl} = \frac{K \sqrt{\Lambda_o u_o}}{x}$$

where K is a constant whose value varies from 5 to 7 (Tuve 1953).

The air entrainment ratio at any distance x is given by

$$\frac{q_x}{q_0} = \frac{u_0}{u_{cl'x}}$$

Applying these equations, the flow pattern in the jet stream was found out.

5.10.2 <u>Velocity Distribution at Outlets:</u>

The discharge through an outlet opening is given by the product of its area and the velocity of flow.

$$Q_{O} = A_{O} V_{O}$$

where Q is the rate of flow, A is the free area of outlet and V is the face velocity.

Assuming that air enters through an imaginary spherical surface, the velocity at any distance can be obtained by equating the flow through the outlet and that through the imaginary spherical surface, at that distance.

$$\Lambda_{\mathcal{O}}V_{\mathcal{O}} = \Lambda_{\mathcal{X}}V_{\mathcal{X}}$$

The imaginary spherical surface may be a whole sphere, hemisphere, quarter sphere, or any other fraction of a sphere depending on the number and position of flanking planes. An emperical relation for the discharge at a distance x

is given by Dalla Valle (1946) as

 $Q_{x} = V_{x}(10X^{2} + \Lambda_{0})$ for plain outlets. For flanged outlets,

$$Q_{x} = 0.75 V_{x}(10x^{2} + \Lambda_{0})$$

where Λ_0 is the face area of the outlet.

Silverman and Leslie (1942) give the exhaust air volume for plain slots with aspect ratio ($\frac{W}{L}$), 0.2 or less as

$$Q = 3.7 LVX$$

and for flanged slot of same aspect ratio as

$$Q = 2.8 LVX$$

where L is the length of the slot V is the velocity at a distance X.

Applying these equations the velocity distributions in areas of interest were determined. The transport of particulate for the flow patterns developed and hence, the efficiency of a ventilation system in controlling particulate pollution were found out.

A more rigorous method would be the application of Laplace's equation (Robertson 1965) to determine the velocity distribution in the whole room for assumed inlet and outlet conditions and to choose the ideal one from considerations of economy and efficiency.

5.12 AIR FLOW UNDER NATURAL VENTILATION CONDITION

Under natural ventulation condition, air flows into and out of a room by the action of either wind or temperature difference between the inside and outside of the room or by a combined action of the two.

5.11.1 Air flow due to wind:

The quantity of air forced through a ventilation opening by the action of wind, is given by the equation (Randall and Conover 1931),

Q = EAV

where,

Q = air flow. cfm

 Λ = free arca of inlet opening, sq.ft.

V = wind velocity, fpn; and

E = effectiveness factor (0.5 to 0.6 for perpendicular wind and 0.25 to 0.35 for diagonal wind)

5.11.2 Air flow due to temperature difference:

When temperature in a building is different from outside temperature pressure difference between inside and outside occurs as a result of difference in air density. This is called chimney effect and it causes inward or outward flow given by the equation,

5.12 CONCENTRATION TRANSPORT

Concentration, as temperature, moves from a higher state to lower state.

5.12.1 Horizontal transport:

The percent decrease of concentration in the horizontal direction is given by the equation

$$\frac{-dC}{dL} = \lambda C$$

where C concentration at distance L,

L = Distance from source and

 λ = transport coefficient.

Integration of the equation gives the result,

$$\log \frac{c_o}{c} = \lambda L.$$

A plot of log $\frac{c_0}{c}$ V_sL gives a straight line and the value of λ can be found out.

The same equation may applied for vertical transport with L changed to Z, where Z is the height.

5.12.2 Transport due to eddy Diffusion:

If a turbulent flow raises particles deposited in a duct a distribution of them becomes established along the

height. The upward movement of particles by eddy diffusion through an area of l cn² in l sec is given by $-D_t$ $\frac{d}{d_z}$ where D_t is the eddy diffusion. The downward movement of particles by gravity through the sinc area for l sec is given by

 V_sn , where V_s is the settling velocity and n is the concentration.

Equating the expressions (Fuchs 1964)

$$\frac{dn}{n} = -\frac{v_s}{D_t} dz,$$

Whence

$$\ln \frac{n}{n_0} = -V_s \int_{0}^{z} \frac{dz}{D_t}$$

For the central region where $\boldsymbol{D}_{\boldsymbol{t}}$ is almost constant, the equation takes the form

$$\ln \frac{n}{n_0} = -\frac{\nabla s^z}{D_t}$$

Where n_0 is the concentration at the bottom and n_0 , the concentration at height z_0 .

For a particular sample—taking $V_{\rm S}$ as the settling velocity of mean size particles and substituting in the equation, it takes the form of equation given in 5.12.1. The value $D_{\rm t}$, the eddy diffusion coefficient can thus be determined.

CHAPTER VI

RESULTS AND DISCUSSIONS


PART A PARTICULATE POLIUTION AND HAZARDS

6.1 POLLUTION HAZARDS IN THE JUTE MILLS

6.1.1 Particulate Concentrations in various sections of a jute mill and seasonal variations therein

- Fig. 6.1 shows the seasonal variations of particulate concentrations in the various sections of the jute mill. The following points can be noted from the graph.
- a) The particulate concentrations in the softener and carding sections are high compared to the drawing, spinning and weaving sections. As exhausts are also provided in softener and carding sections, the higher concentrations are obviously due to the major sources of pollution being located in these sections.
- b) Considering the variation in the particulate concentrations from the softener section end (starting end) of the factory and moving towards the weaving end (other end), one can find that, in general, there is a trend of decrease in concentrations. This is especially true for the case of summers as indicated by the curve for April.

 During this month, cool and humidified air is admitted

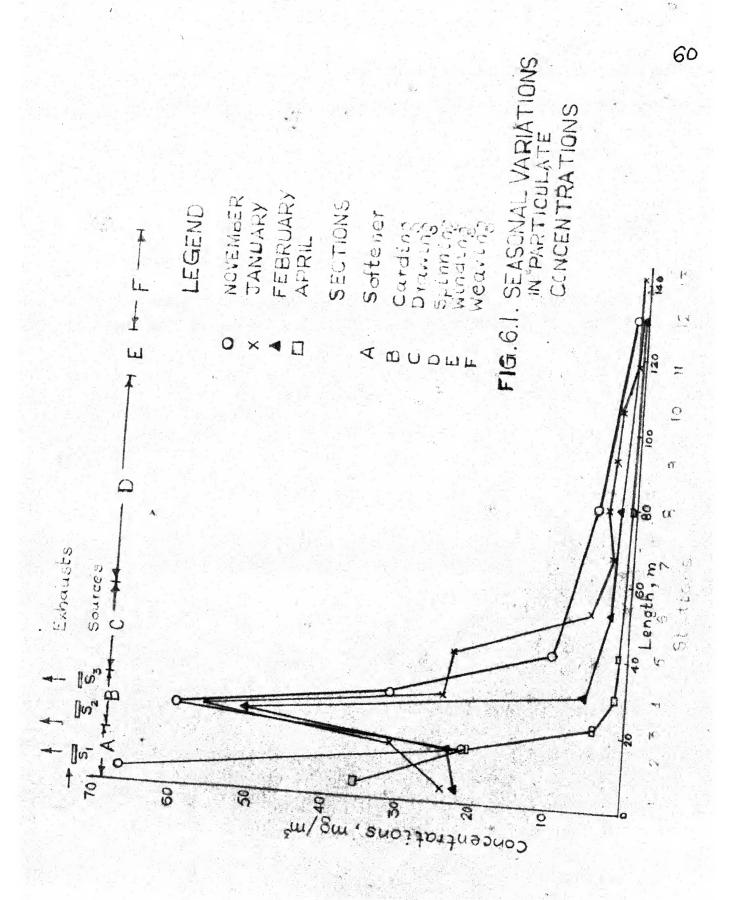

into the room which leads to lesser production of particulates and also their rather quick removal by increased ventilation.

- 3) In seasons other than summer, when cold humid air is not admitted, the maximum particulate concentration seems to be reached between the carding machines situated a short distance downstream of the softener end. This, obviously, would be due to the large amount of particulate production during carding. It should be noted that this condition does not apply to the curve for April when only very little dust seems to be produced during carding. The particulate concentration during April was recorded to be 4.0 mg/m3 as against $50 - 59 \text{ mg/m}^3$ for the other three months. Due to limitation of time no observations could be taken during the rainy reason. However, it is expected that due to higher humidity the particulate concentrations during the months from pril to September will follow, generally, the pattern of the curve for April.
- d) In the short distance from the starting end up to station 2 the particulate concentration variations seem to be slightly erratic. This may be due to the different relative qualities of particulates produced between the softener and carding sections and due to different

amounts of humidity and ventulation present in these sections. Whereas for the curve of April, there is a steep and almost straight-line decrease in particulate concentration from 35 mg/m³ at station 1 to 4 mg/m³ at at station 3, for the curve for November one finds a decrease from station 1 to station 2 and then an increase from station 2 to station 3. For the curves for January and February, even between stations 1 and 2, there is a slight increase. This may be due to a relatively higher production of dust in the carding section as compared to the softener section.

- e) As one moves from station 3 to station 4 there is a rather sharp decrease in concentration during February compared to other seasons. This is due to the opening of windows at the beginning of the drawing section during this season. The outside air, then, flows across the length of the room reducing the transport of particulates into the finishing sections.
- f) Considering the overall variations and knowing the humidity ventilation patterns, it is felt that concentration variations can be devided into two seasonal catagories.

 This inference is made from the point that the curves for November, January and February are not only similar in

terms of general trends but also the values at any particular station for these three curves are rather close. The ranges of particulate concentrations at different sections can thus be predicted to be of the order given in Table 6.1. If one were to assume the expected ranges as given, it would seem that, the particulate concentrations during October to March will be much higher and the dust problems in summer would be less because of cold air inlet and also during raily season because of natural humidity.

6.1.2 Variations of Particulate Concentrations with Height

Figs. 6.2 and 6.3 show variations in particulate concentrations with height in the different sections of the jute mill during the month of January 1975. The following points are observed from Fig. 6.2.


- a) The concentrations, in general, at any station decrease with height, the gradients depending on the height of source, presence of exhaust and other openings, and the nature of pollutant.
- b) At heights of 50 cm and 300 cm above floor level, the particulate concentrations were found to be decreasing as one moves from station 1 to station 2. But at 150 cm height, the concentration increased as one proceeds from station 1 to station 2. The explanation for this is the fact

Table 6.1 Expected particulate concentrations at breathing height (150 cm above flow) at worker positions in various sections of a jute mill

Station	Section	Distance from be- ginning end (m)	Expected commarch	ncentra April Septer ber	to	(mg/m ³) Ratio
l.	Softener	4.0	20 - 70	About	35	0.6-2.0
2.	Carding (beginning)	14.5	20 - 30	1	20	1.0-1.5
3.	Between Carding machines	21.5	50 - 60	1	4	12 - 15
4.	Drawing (beginning)	28.5	5 - 30	1	1.5	3– 20
5.	Drawing (middle)	41,0	4 - 23	1	1.0	4 – 23
6.	Spinning	80.0	2 - 5	1	0.8	2.5-6
7.	Weaving	131.0	1 - 1.5	1	0.5	2-3

that the concentration at station 2 at a hight of 150 cm is contributed by the carding machines with source at a height around 1.5 m above flour level, rather than being transported from the softening section.

. .

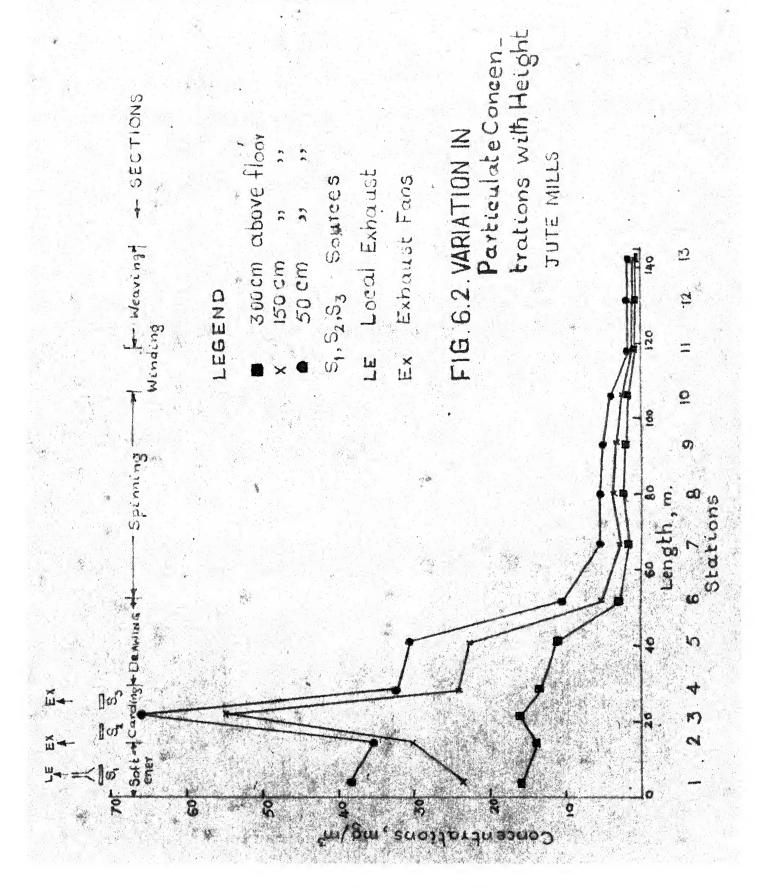

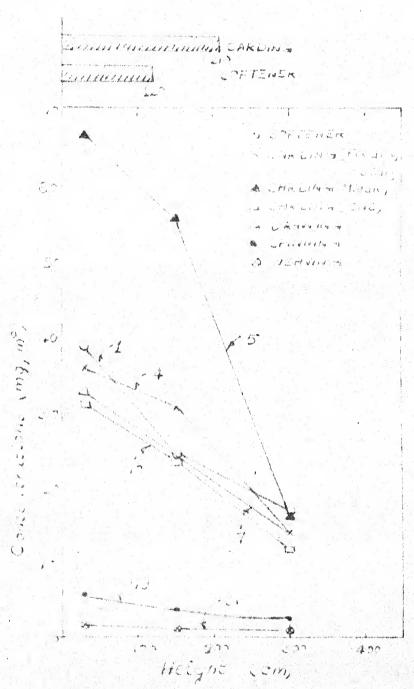


FIG. 6. JUNCENTRATION GRADIENTS
ALUNG HEIGHT-JUTE MILLS

- c) The higher concentrations between the carding machines is as expected. The relatively higher concentration at 50 cm level is due to the settling of bigger and heavier particulates produced in this section. The concentration at 150 cm is high because of the higher elevation of the sources. Presence of exhausts on the roof explains the lower concentration at 300 cm height.
- d) For all heights observed the concentrations in the spinning section are low and uniform because of the lower production and good mixing by the turbulance in air produced by spinning machines. In weaving section also the concentrations are low and uniform due to the same reasons.
- Fig. 6.3 shows the concentration gradients along the height of the room in various sections during January. The following inferences could be made from the graph.
- a) In the softener area steeper gradients are seen in the first 150 cm height compared to the next 150 cm height.

 This may be due to the settling of heavier particulates to the bottom, the lower height of source, the cross draught produced by the low wind blowing in through the door and the local exhaust provided over the softener.
- b) Curves 4, 5 and 7 show the variations in concentrations in the carding section. The influence of the exhaust fans

on roof is given by the shapes of curves 4 and 5. The concentrations at higher elevations are considerably reduced by the constant removal of pollutants. The lower points are comparatively less influencedby exhaust fans indicated by the latively flatter gradients similar to those in other areas.


c) Curves 10, 19 and 31 show the variations in sections where no exhaust arrangements are provided. The variation was found to be uniform and almost of same nature in all the three sections.


6.1.3 Hygienic significance of particulate size distribution

Figs. 6.4 and 6.5 show the size distributions of dust and fibres respectively in the room air in various sections of the jute mill. The mean sizes and percentages of dust and fibre of hygienic importance are shown in Table 6.2.

The following points could be noted in the results:

a) The mean sizes of dust are maximum in the softener and carding sections of the mill. This could be expected because the bigger particles are easily removed from the jute and hence their percentage will be more in the initial stages of processing.

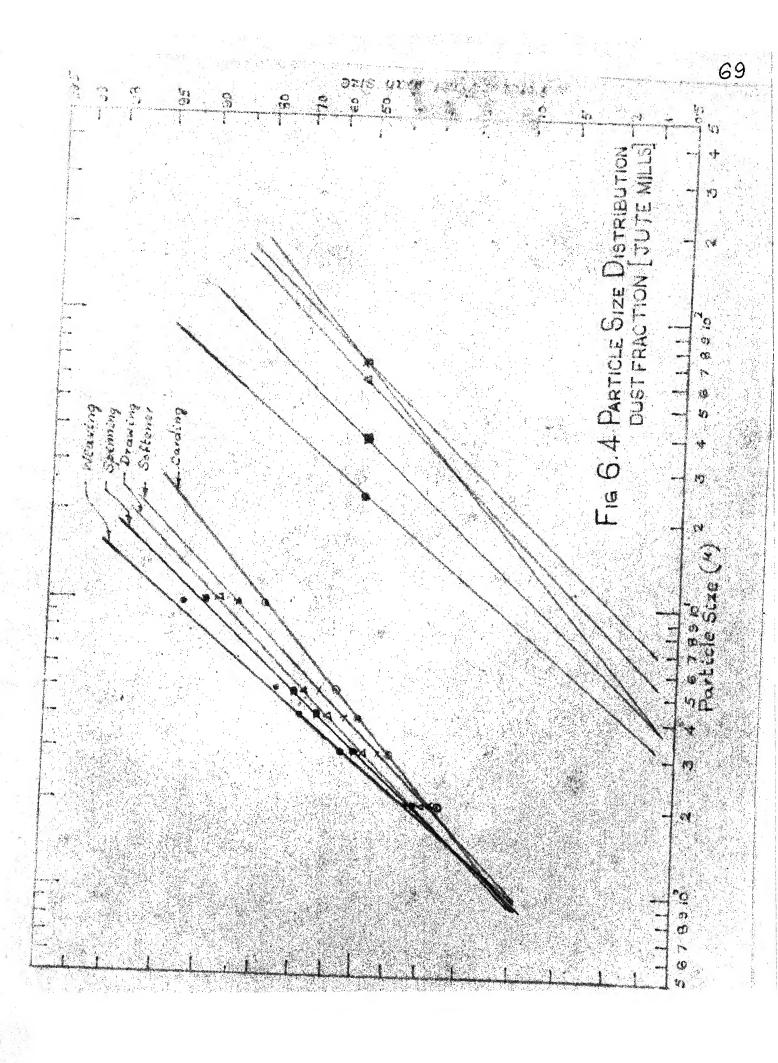

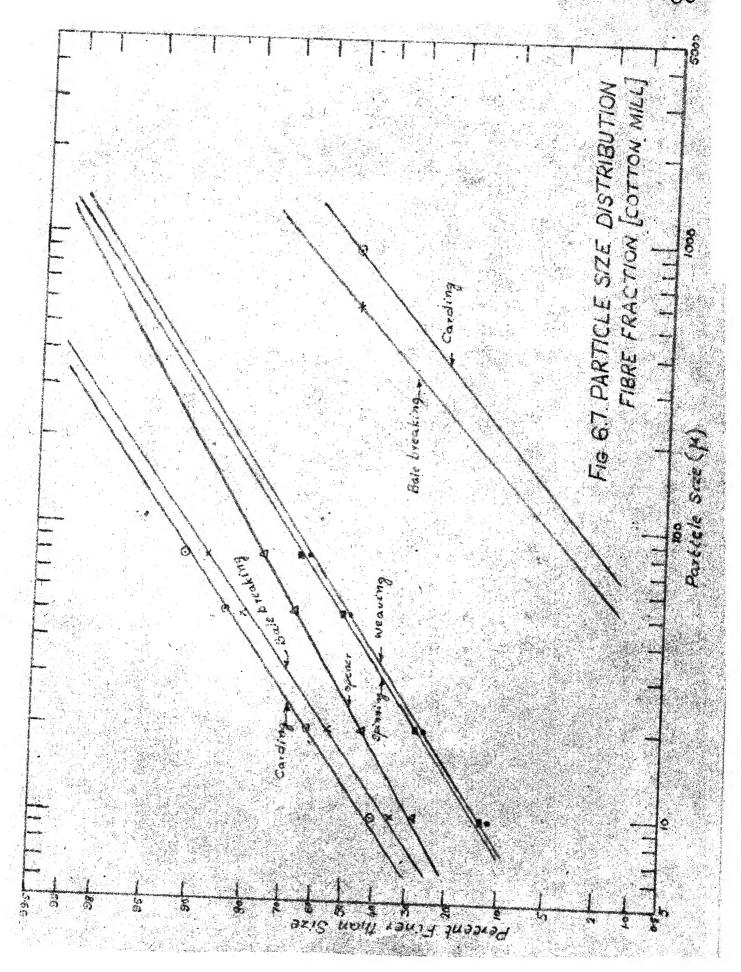

Hygienic significance of particulates in jute mill room air Table 6.2

		The second secon	The state of the s				
Section	Range of particulate concentration (mg/m ²)	Geonetric nean size by number (u)	Standard deviat- ion	Geonetric nean size by wt.	%by wt of particulates	%by - wt. - of part	by wt.retained wt. in workers of lungs part. (µg/day)
DUST FRACTION							
Softener	21.0-66.0	3,60	2.70	68,60	2,3	0.5	162,5-510,0
Carding	4.5-78.0	4.00	2,70	06.79	5.0	1.8	73.0-1265.0
Drawing	2.1-30.6	3.10	2.70	59.10	3.5	1.0	10.8-161.2
Spinning	1.5-5.8	2,90	2.50	36.00	8.0	2.4	9.3- 36.0
Weaving	0.5-1.6	2.70	2.30	23.52	15.0	4.6	4.1-13.0
FIBRE FRACTION	CTION						
Softener	As above	18.00	3.70	2663.00	0.1	negl.	negligible
Carding	-	25.60	6,20 5	547300.00	0.1		-
Drawing	-	65.00	7.50 6	00.001599	negl.	~	-
Spinning	-	74.30	4.30	42760.00	-	-	-
Weaving	-	81,10	4.20	38770.00	-	-	a n-

 $^{^{+}}$ a maximum concentration of 1.35.0 mg/m 3 was observed in the softenor section of the old mill of this factory.

- b) The mean sizes of dust were found to be reducing from one station to another as one moved from the softener section to the weaving section. The reduction was more in the initial stages compared to later stages. This is because of the removal of heavier particles in the initial stages, mainly by settling. The removal of smaller particles by settling is not easy. Also they move with the air medium and hence the lower variation in mean sizes in the latter sections.
- c) In the case of fibre fractions the mean sizes were found to be increasing as one moved from softener to weaving sections.

 This is because bigger and bigger fibres escape from the jute processing in the latter sections.
- d) The percent-fractions of dust of hygienic importance (below 10 micron size) in the total dust content was found to be increasing from softener to other sections.

 This should be the case because finer particles predominates in the room air of the latter sections. The quantity of dust retained in the lungs of workers (Brown et al. 1960) is more in the initial stages because of the higher overall concentrations and higher percentage of dust fractions there.

6.1.4 Presence of free Silica:

Tests carried out to determine the presence of free silica in the particulates of room air gave results shown in Table 6.3.

Table 6.3 Free Silica content of the total particulates in factory room air

Section	Particulate concentrat- ions(, , /n ³)	Silica content (percent) ng/m ³
Softener	21.0-56.0	8.31 1.74-5.47
Carding	4.5-78.0	4.23 0.19-3.30
Drawing	2.1-3).6	0.65 0.01-0.20
Spinning	1.5- 5.8	negli. negligible
Weaving	0.5- 1.6	t t

The silica content was observed to be maximum in the softener region, which meduced to almost half in carding section and to negligible amounts in other sections. The results indicate that the silica might have been present only as larger particulates and hence might have been removed

by settling in the initial stages. It is also indicative of the property of siliceous matter to form larger particles by flocculation. In that case the silica might have been initially present in smaller particle sizes and later flocculated and quickly removed.

6.1.5 Viable microorganisms in factory room air :

Table 6.4 gives total plate count of microorganisms present in factory room air determined by using nutrient agar and incubated at $35 \pm 2^{\circ}\text{C}$.

The results are self explanatory. In the sofener and carding sections where the particulate concentrations are maximum, the number of organisms are also very high. However, no linear relation was seemd to exist between the number of microorganisms and particulate concentrations. The microorganisms present were lise not related to the number of persons occupying the different sections. The implication is that workers are not the source of such microorganisms in the room air. The lower counts in the latter sections indicate that organisms may be attached mainly to bigger particulates which are easily removed.

6.1.6 Pollution hazards in jute mills:

From the results of the studies made, the pollution hazards in jute mills may be summarized as follows:

Viable microorganisms in factory room air (Nutrient Agar - 3500) Table 6.4

Section	No. of	Vol. of	Vol. of			Total count	unt	No of
	workerst	air san- pled(1)	dil.water (nļ)	Plate I	Plate Plate I II	Plate III	av:	organishs per m ⁵ of
Softener	4	15	15	75	50	09	61.6	99919
Carding	45	15	15	43	30	41	38.0	38630
Drawing	20	15	15	ω	10	11	9.6	9996
${ t Spinnln} { t g}$	40	15	15	9	72	7	5.0	2 C 00
Weaving	120	15	15	2	4	М	3.3	3333

+ Persons noving products from section to section are not included

- 1) The particulate concentration in the working environment of the jute mill studied ranged from 0.5 mg/m³ to 135 mg/m³ compared to the parmissible limit of 1 mg/m³ fixed by the American Con prence of Governmental Industrial Hygienists (Schilling 1971).
- 2) The amount of particulates of hygienic importance as percent by weight of total particulates ranged from 0.5 to 4.6, the least value being in softener section and maximum in weaving section. The weight of particulates retained in the lungs of workers was found to be maximum in the carding section followed by softener, drawing, spinning and weaving sections. The maximum value for carding sections was calculated as 1265 µg/8-hr day. The minimum value of . 1 µg/8-hr day was found in the weaving section. The efice of this may be detrimental to the health of workers.
- The silica content of particulate concentrations in factory room air was found to be high compared to the threshold limits fixed by American Conference of Industrial Hygienists (1963).
- 4) The number of microorganisms present in the occupied space, especially the softener and carding sections, were observed to be quite high compared to the value of

1500/m³ in normal occupied rooms as reported by Wright et al (1969). In this connection no section was found to have a value less than the normal value reported.

6.1.7 <u>Effect of pollution on workers - Results of Health</u> Survey:

Interview of workers from various departments of the jute mill to ascertain the effect of particulate pollution gave the following results. Table 6.5 gives the percentages of workers in different sections who have some complaint likely to be connected with particulate pollution. As expected the maximum number of persons were found to be affected in the highly polluted softener and carding sections. Columns 4 and 6 give number of persons with symptoms of Byssinosis (Schilling 1971). Only persons from softener and carding sections have this complaint. Considering the higher concentrations of particulates, the percentages of affected cases are low compared to reported values for cotton mills (Schilling 1971). Tables 6.6 and 6.7 show relations of age and years of service of workers to effect of pollution. The tables are prepared from data for softener and carding sections only. All age groups were found to be affected by pollution. But percentages of affected cases were nore in the upper age levels. Also.

6.5 Affect of particulate pollution on workers in the jute mills Table

Soction	No. of	N_t	Number of workers affected	s affected		
	workers interviewed	Sone diffi- culty	Special difficulty on first	Cough	Tightness of chess	Other chest symptoms
1.	2.	3.	4	5.	• 9	7.
Softener	20	18(90)+	3(15)	16(80)	3(15)	2(10)
Carding	20	17(85)	3(15)	17(85)	4(20)	2(10)
Drawing	20	5(25)	NIT(()	4(20)	(C)TIN	1(5)
Spinning	20	2(10)	NIT(()	2(10)	NIT(0)	2(10)
Weaving	20	2(10)	NIT(()	1(5)		(O)TIN

+ Numbers in parentheses show percent prevalence of cafes

Table 6.6 Relation of age of workers to effect of pollution

		to the second se	
Age Group	Total No. of workers	Number of affected cases	Percent affected
Below 20	3	2	66.6
21 - 30	19	17	89.5
31 - 40	9	8	88.8
41 - 50	7	6	85.7
Above 50	2	2	100.0

Table 6.7 Relation of years of service to effect of pollution

Years of Service	Total No. of workers	Number of affected cases	Percent affected
Less than 5	8	6	75.0
5 - 10	17	15	88.2
11 - 15	6	5	84.2
16 - 20	4	4	0.001
21 - 25	2	2	130.0
Above 25	3	3	100.0

6.2 POLLUTION CONDITIONS IN A COTTON MILL

Table 6.8 shows the concentrations of particulate pollutants in different sections of a cotton mill. It also gives the mean sizes, percent-fraction of dust of hygienic significance and the probable amount of dust that may be deposited in the lungs of workers. Figs. 6.6 and 6.7 give the size distributions of dust and fibre fractions respectively.

Maximum particulate concentration was observed in the bale breaking section followed by old type carding section. The section of new carding machines with local exhaust system showed least particulate pollution. Except this, in all other sections particulate concentrations were observed to be higher than the recommended value (Schilling 1971). The observations showed that only dust poses a health hazard in cotton mills. Fibre, eventhough present, was not found to be hygienically dangerous, being of size much larger than 10 μ.

6.3 POLLUTION CONDITIONS IN A WOOLLEN MILL

The particulate concentrations in a few polluted sections of a woollen nill are given in Table 6.9. It also gives the mean sizes, and percentages of dust and fibre of hyginally important sizes. Figs. 6.8 and 6.9 give the size distribution of dust and fibre fractions of particulate in three sections of the woollen nill.

Table 6.8 Concentrations particle size distributions and hygienic si nificance of particulates in a cotton mill+

		DUST FRACT		
Sections	Concentration (ng/m ³)	Geometric µmean si- ze (µ)		%by wt.of size ∠10 µ
Bale Breaking	11.4	4.1	2.6	2.6
Opener	6.5	2.5	2.1	11.5
Carding (old type)	8.3	2.4	2.2	35.0
Carding (new type)	0.5	negl.	negl.	negl.
Spinning	5.4	2.2	2.1	41.0
Weaving	3.6	2.1	2.0	57.0

FIBRE FRACTION DUST FRACTION wt.retainc] %by wt. of zby wt. of Geometric Standard size -6 µ size < 10 µ in lungs ci mean size deviation workers (μ) (µg/day) 266.5 16.2 0.65 3.8 negl. 3.01 25.5 198.0 5.4 14.00 782.0 12.3 4.1 negl. negl. negl. negl. 4.2 17.00 121.0 45.0 4.0 28.00 116.3 47.0

^{*} Measurements are made at breathing level at worker positions.

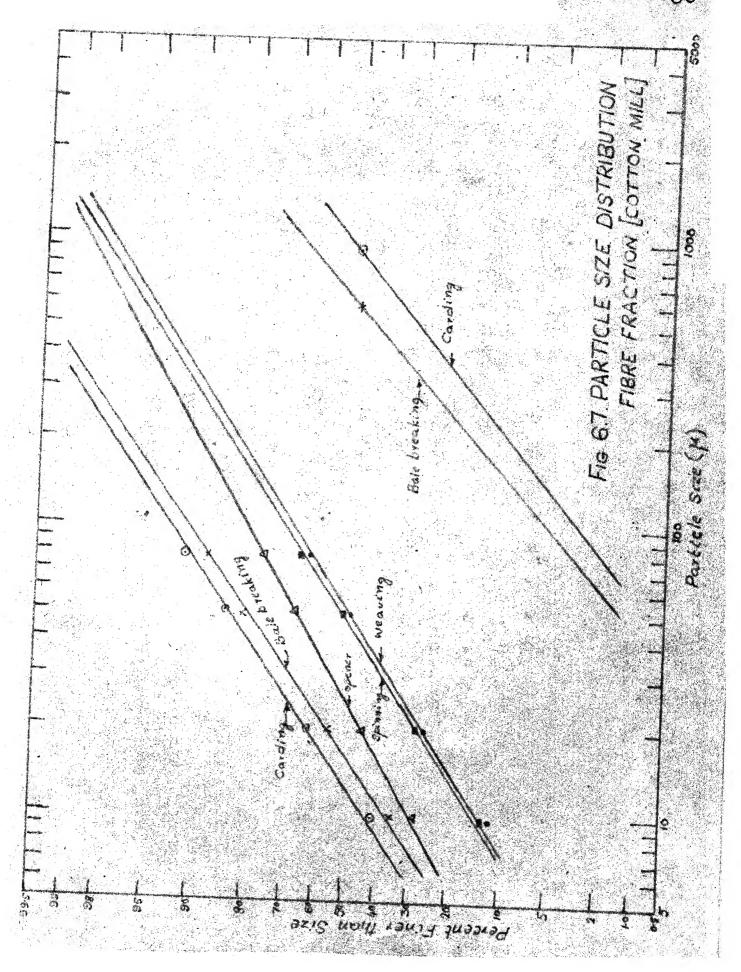



Table 6.9 Details of particulates in various sections of of a woollen mill+


Sections	Concentra-		DUST	FRACTION	
	tions (ng/n ³)	Geometric Moan size (µ)	Standard deviati- on	%by wt. o size <10 μ	of yby wt.of size <6 µ
Scouring	64.00	4.2	2.8	1.1	0.3
Carding (old type)	5.13	2.4	2.2	10.1	2.6
Carding (new type)	0.22	negl.	negl.	negl.	negl.
Spinning	0.42	2.2	2.0	55.0	26.0
		M. Sekel (1800) M. Lai van den mendele proprie sebelah penjaman penjambah penjaman penjambah penjambah penjamb			Aleman and the second

......continued

DUST FRACTION		FIBRE FRACTION	ALSO WARREST AND A COMMUNICATION OF THE PROPERTY OF THE PROPER
wt.retained in lungs of workers(µg/day)	Geometric mean size (µ)	Standard deviation	Percent by wt. of size <10 µ
7 53	31.	4.0-	negligible
55	20.0	4.2	1
negl.	negl.	negl.	t
21	45.0	4.6	t

^{*} Measurements are made at breathing at worker positions.

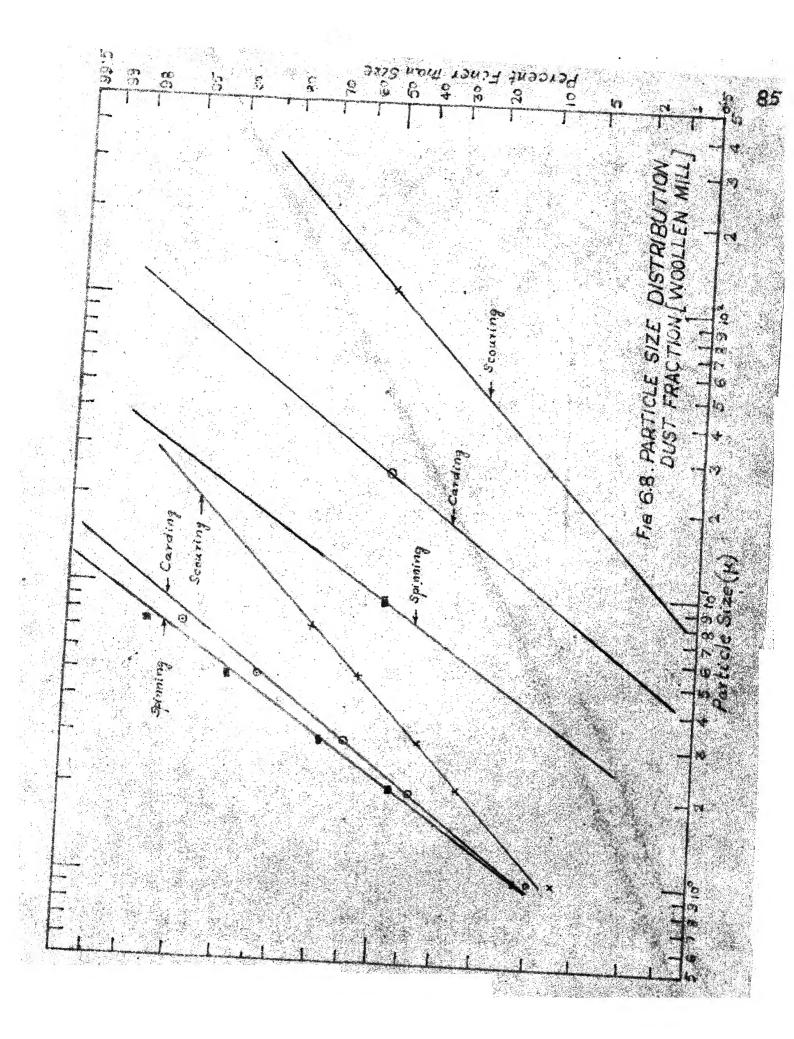

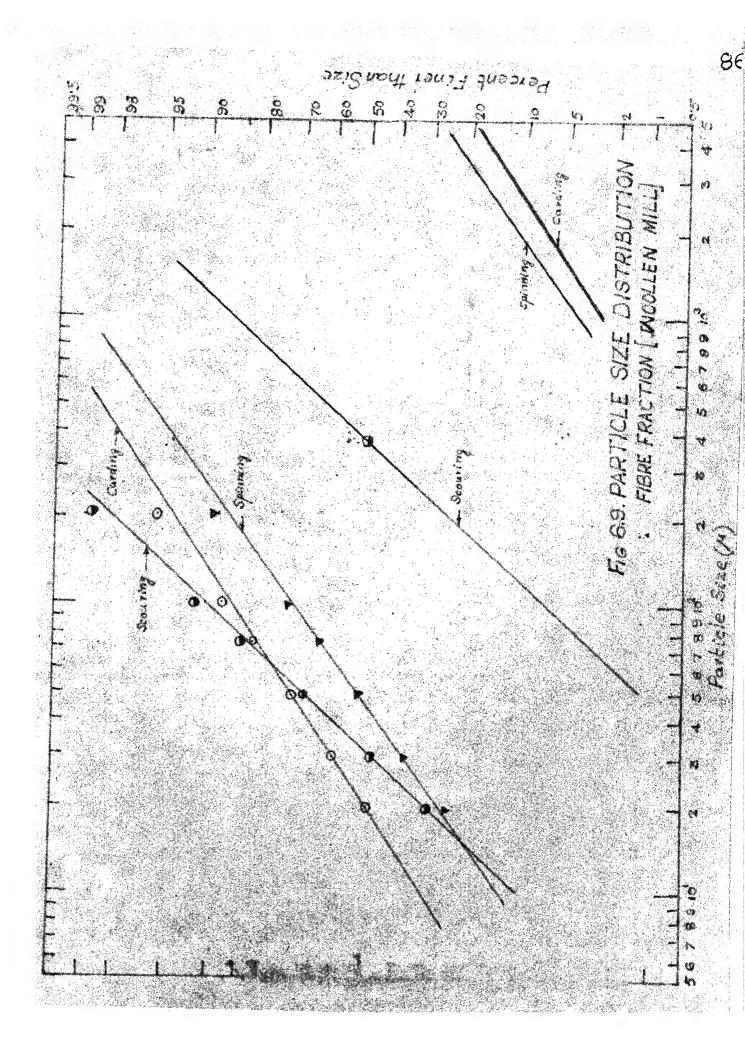

It has been observed that particulate pollution was serious only in the feeling end of the scouring section of the mill where a concentration of 64 mg/m³ was recorded. In all other sections except the old type carding section (where a concentration of 5.13 mg/m³ was observed), the concentrations were below the recommended level (Schilling 1971). The reason for the low level concentrations in different sections of woollen mills except the scouring section may be attributed to the efficient removal of dirt and grease by the scouring action.

Health hazard due to the dust pollution was found to be maximum in the scouring section. Hazard due to fibre pollution was found to be negligible in all sections of the mill.

6.4 COMPARISON OF POLLUTIONAL HAZARDS IN THE THREE FIBRE FACTORIES

Fig. 6.10 shows a comparative picture of the pollution conditions in the three types of fibre factories where studies were carried out. The measurements were taken during the month of April, 1975.

The hazards of dust pollution were found to be maximum in the preparing stages in all the three mills. The weight concentration was found to be high in the scouring section of the woollen mill and the same was due to the high percentage of fixed solids in the particulates. The fixed

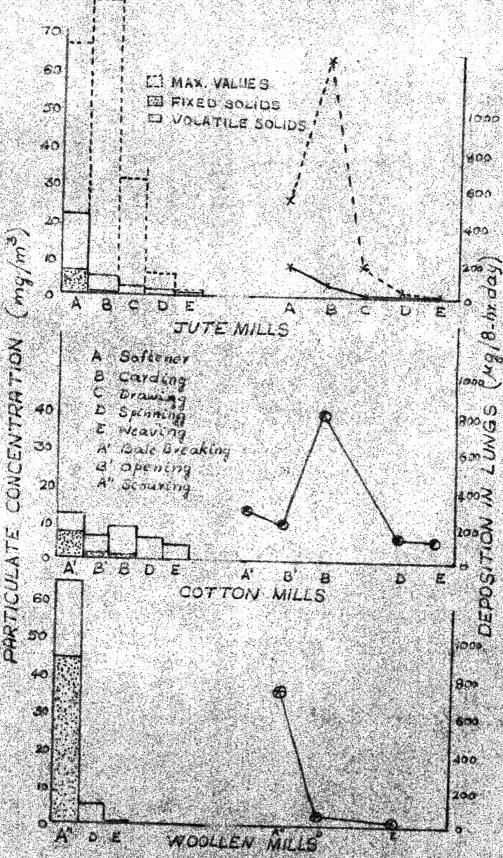


Fig. 6.10 PARTICULATE POLLUTION IN VARIOUS FIBRE FACTORIES AND ITS EFFECT ON WORKERS

solids are also high in the bale breaking section of the cotton mill. But they are removed to a large extent in the first process itself. The cotton mill has some pollution hazard in almost all sections. This may be due to the special nature of cotton from which removal of foreign matter is difficult. Also the fibres are shorter and thinner and have The weight of partiless strength compared to other fibres. culates that may, probably, be retained in the lungs of workers are also shown in Fig. 6.10. The jute mills has the least values in this respect. This is mainly due to the cold air supply which has been provided, at the time of study. maximum values observed during other seasons are shown by dotted In the cotton mill also cold air is supplied. its effectiveness in reducing particulate pollution in the carding section was found to be lower compared to that in the In the woollen mill no cool air supply is provijute mills. The workers are, therefore, /subjected to high temperature stresses during the summer months.

Thus the highest health hazard due to particulate pollution will be in the (i) Scouring section of the woollen mills (all the year round) (ii) Bale breaking section and to a lesser extent the carding section in a cotton mills (more hazard during winters due to poorer ventilation) and (iii) a jute mill (once again more hazard during winters).

In all cases improved ventulation whether on a local basis (e.g. a small exhaust fan or a window) or complete air changing will, very significantly, reduce the particulate concentrations and hence the resulting hazard.

PART B VENTILATION AND POLLUTANT TRANSPORT

6.5 EXISTING VENTILATION CONDITIONS IN THE JUTE MILL

6.5.1 Natural Ventilation

The flow caused by perflation (inflow due to wind action) was found to `3 90,000 m³/hr in January and 150,000 m³/hr in February. These flows are capable of giving 4.15 and 6.92 air changes per hour. The structural conditions on the western side do not permit flow due to aspiration (outflow due to wind action). The maximum difference in temperature between inside and outside was found to be 30°F during summer as well as winter seasons. The flow caused by this temperature difference was found to be 20,500 m³/hr in January and 26,300 m³/hr in February. The total air changes due to the combined effect were calculated to be 4.87 in January and 8.12 in February. These air changes were found to be incapable of reducing particulate pollution to the permissible levels.

6.5.2 Seasonal variation in Total MAir flow rates:

Based on measured values of velocities and areas of openings, the total (including both natural and forced ventilation) air flow rates into and out of the factory room during three periods were calculated. In January, the flow was sufficient to give a total of 7.01 air changes per hour. In February, similar calculations yield 10.1 air changes per hour. The increased flow rate was found to be due to increased prevailing winds during this season. (The meteorological data presented in Fig. 6.11 shows the variations in wind speed, temperature, and relative humidity). In April when cool air was supplied into the room, the number of air changes increased to as high as 32.0 per hour.

6.5.3 Relation of particulate concentrations to ventilation:

Fig. 6.12 shows the relation between the number of air changes and particulate concentrations during the periods of study. All curves except 1 and 2 representing the carding and softener sections respectively show similar trends. In carding section where more exhausts are provided there is a marked reduction in particulate concentration with increased air changes indicated by the steepness of the curve throughout its length. In the softener section where no air supply point is provided it was found that increase in total air

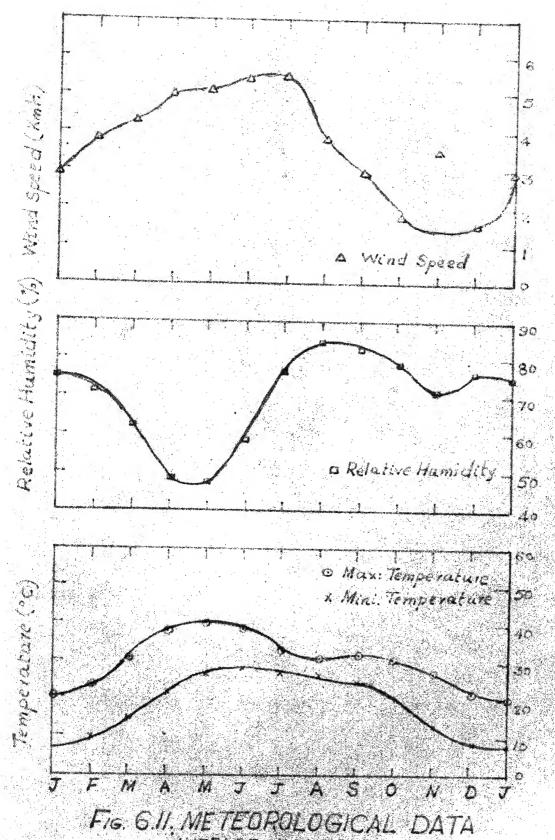


Fig. 6.11. METEUROLOGICAL DATA AVERAGE VALUES 1971-175

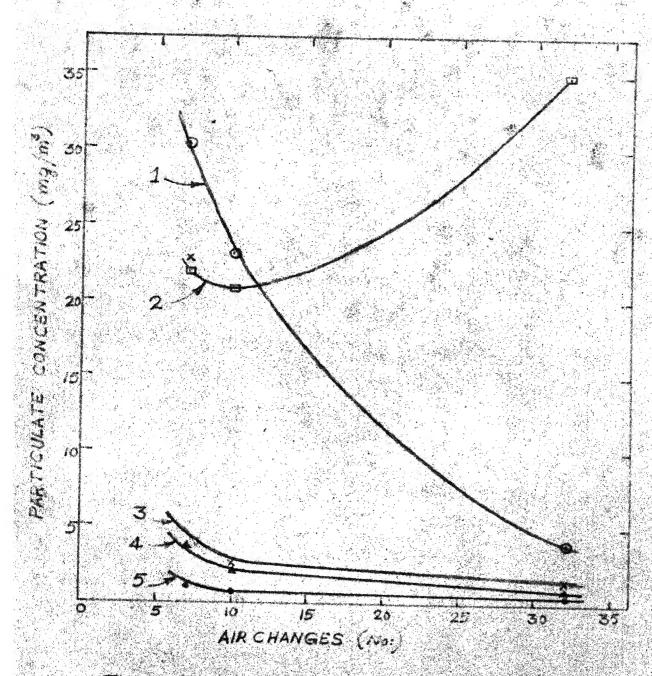



Fig 6.12. RELATION BETWEEN AIR CHANGES
AND PARTICULATE CONCENTRATIONS

6.6 VELOCITY DISTRIBUTION INSIDE FACTORY ROOM

6.6.1 Seasonal variations in general air movement:

Figs. 6.13 to 6.15 show the velocity distributions in the factory room during three months when measurements were carried out. In January, the movement was more circulatory in the carding, drawing and weaving sections with linear motion between machines. In February when windows were opened in the carding and drawing sections the movement was more linear from the eastern side to western side. In the upper levels the flow was directed towards the exhaust fans in these sections.

During summer months when cool air was supplied the velocity distribution was as shown in Fig. 6.15. Cool air moved from the sides to the centre where part of it was lowered and part was elevated. At floor level, air moved from centre towards the sides. The direction of flow was observed to be outwards through all the openings due to the increased pressure produced by air supply. In the softener section where no air supply point was provided, the outward flow was found to cause draughts which reduced the efficiency of local exhaust hood over the softener. The particulate concentration in this section was observed to be high due to this reasons.

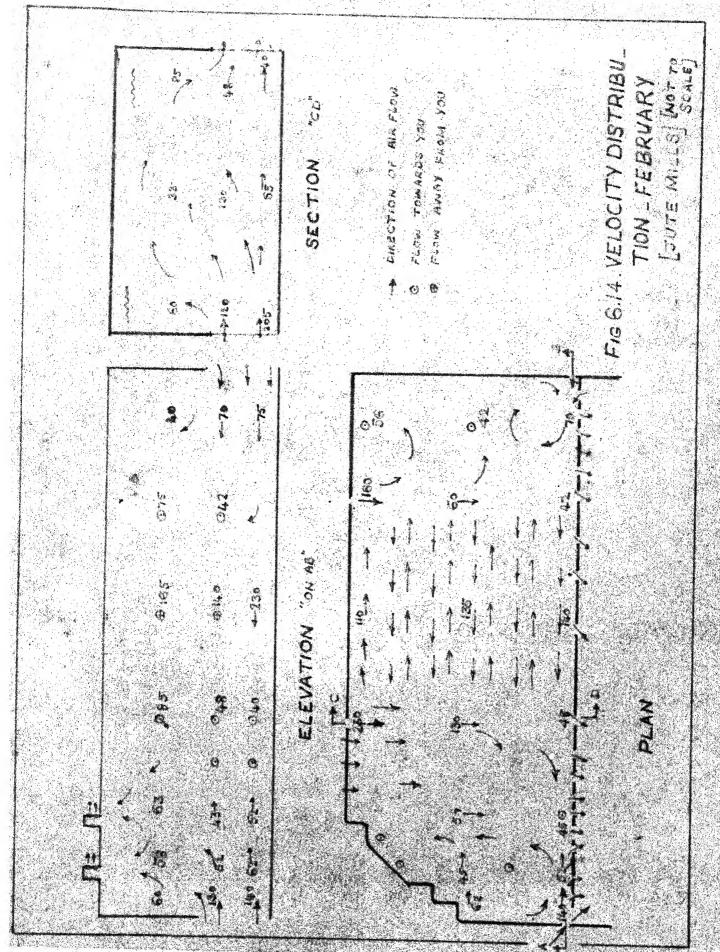

6.6.2 Velocity distribution around machinery:

The moving parts of some machines induced air velocities around them. This was mainly noticed in the spinning section of the mill. It was observed that the high speed rotation of the spinning rings produced a velocity of 900 fpm at 8 cm from the ring on the facing side of the machine. The velocity was found to be reduced to 50 fpm in a distance of 60 cms. On the rear side of the machines the velocities observed were around 50 fpm. In no other section the movement of machine parts was found to induce velocities above 50 fpm at a distance of 10 cm from the machine, where it was possible to do measurements.

6.6.3 Velocity distribution in air stream of supply inlets:

Measured values of the centre line velocities of air inlets provided on the side walls are shown in Fig. 6.16. The velocity distribution shows that it does not fully agree with the equation for free stream jet (Schlichting 1958), $\frac{U_{cl}}{U_{o}} = \frac{K}{x}$, where K is a constant. The reason for the same may be the obstructions caused by machinery and the effect of floor, a making the jet not absolutely free stream.

6.7 TEMPERATURE AND HUMIDITY CHANGES IN THE FACTORY ROOM

Table 6.10 gives the temperature and relative humidity in the factory room during the three periods of measurements.

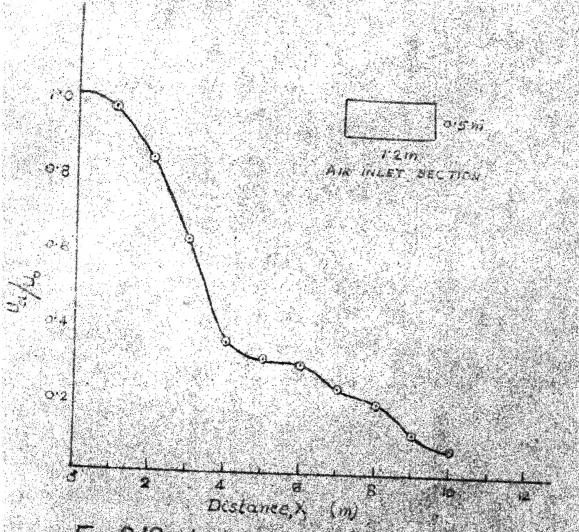


Fig 6.16: VELOCITY DISTRIBUTION AT INLETS

Table 6.10 Temperature and relative humidity in factory room and outside

Section	Tenj Jan	erature Feb	(o _F) Apr	Rela Jan	tive hunid Feb	lity (%) Apr
Softener	73.0	75.0	82.0	64.5	73.5	65.5
Carding	75.0	73.0	79.0	66.0	73.5	73.5
Drawing	77.5	76.5	80.0	63.4	76.2	76.0
Spinning	79.5	81.0	82.0	70.5	76.3	80.0
'eaving	74.5	77.5	83.0	61.5	69.0	69.5
	x. 67.5 n. 45.3	71.1	111.3 70.7	82.5	73.5	49.0


The temperature inside the room showed a maximum rise of to 8.5°F during the period of study. It was found increase with height. The observed difference between floor level and ceiling temperatures ranged from 2 to 5°F. The difference in temperature inside and outside of the room was found to be 30°F below the room temperature during January and 30°F above the room temperature during Linuary. Relative humidity inside the room ranged from 60 to 75 percent whereas it ranged from

82.5 to 49 percent. outside. The narrow ranges of temperature and relative humidity inside the room are due to their artificial control.

6.7.1 Relation of particulate concentrations to temperature and relative hundry

Fig. 6.17 gives a comparison between the variations in temperature, relative humidity and particulate concentrations inside the room. When the difference in temperature between inside and outside is maximum, there should be more airflow and hence more air changes and lower concentrations. But the concentrations were found to be lower only in summer when air was admitted into the room mechanically. In winter, when temperature difference was of the same order as in summer the concentrations recorded were high. These indicate that the flow caused by temperature difference is not sufficient to reduce particulate pollution.

An increase in relative humidity should decrease the particulate concentration because of lower production and higher removal. This condition was found to exist between January and February when relative humidity increased and concentrations decreased. But in April when the relative humidity decreased, the concentrations decreased further in all sections except the softener section. These findings

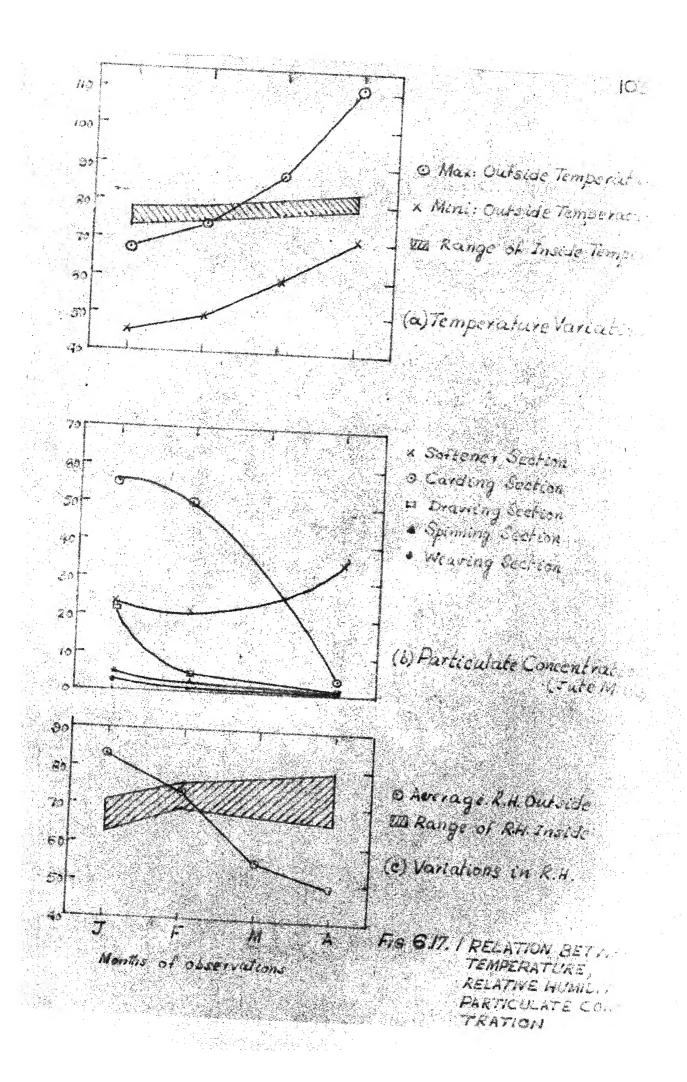

show that there is no lirect relation between temperature and relative humidity variations with change of particulate concentration. Other factors are influencing the particulate concentrations more than temperature and relative humidity.

6.8 PARTICULATE PRODUCTION

Table 6.11 gives a complete picture of the particulate production and transport in the jute mill during February. Particulates produced by various machines were determined by assuming equilibrium condition when production equals transport and settling.

The particulate production was found to be decreasing as we proceed from softener to other machines. This is expociable because the initial processes remove dust and short fibres to the maximum extent. In the drawing section the jute is combed and drawn by the machines. The particulate production is less as the process is very slow. The increase in production in the spinning section is due to the high speed of revolution of the spinning rings and the resulting high velocities. Any foreign matter or short fibres in the thread will be thrown away by this speed. The production in the weaving section is low because very little dust and short fibres will be left on the jute handled in this section.

Table 6.11 Particulate production and transport

Particulars	3		Carding			
	Softener	Brake Cards	Finisher Cards)rawing	Spinning Weaving	Weaving
Flux IN(-)	0	340	5900	2585	150	450
(+) Ino `	340	2900	2122	150	913	0
NET	+ 340 +	- 5560	- 3778	- 2435	+ 763	- 450
$\mathtt{Settling}(g/\mathtt{hr})$	320	2452	4133	2425	107	618
Exhaust (g/hr)	102	757	175	NIL	NIL	NIL
Escape through doors (g/hr)	150	250	650	06	150	220
Production(g/hr)	912	9:55	1180	යට	1,020	388
No. of nachines	Н	හ	10	Ŋ	40	120
Production/nachine (g/hr)	912	1006	131	76	25.5	3.2

6.9 PARTICULATE TRANSPORT


6.9.1 Size distribution of particulates in the room air :


The size distribution of particulates at various heights in the different sections are given in Figs. 6.18 to 6.22. The percentages by weights of the various fractions of the particulates are given in Table 6.12. The mean sizes of particulates by number dispersed into the factory room was found to be ranging from 2.0 to 5.2 microns. The percentages of the lower size fractions were found to be more towards the latter stages of processing. The mean sizes of particulates are larger in the preparing sections because bigger particulates are removed by the initial processes. The quick settling of the bigger particulates and easier transport of finer ones by the room air to other sections give the reason for the smaller mean sizes in the finishing sections.


6.9.2 Relation of particulate transport to size distribution :

The sizes of particulates are so small that a large portion of them will be easily transported by moving air.

According to Hemeon (.1963) particulates of sizes less than 20 microns may be considered as lacking any weight or power of independent motion through air. The larger values of flux in different sections as given in Table 6.11 are indicative of this property.

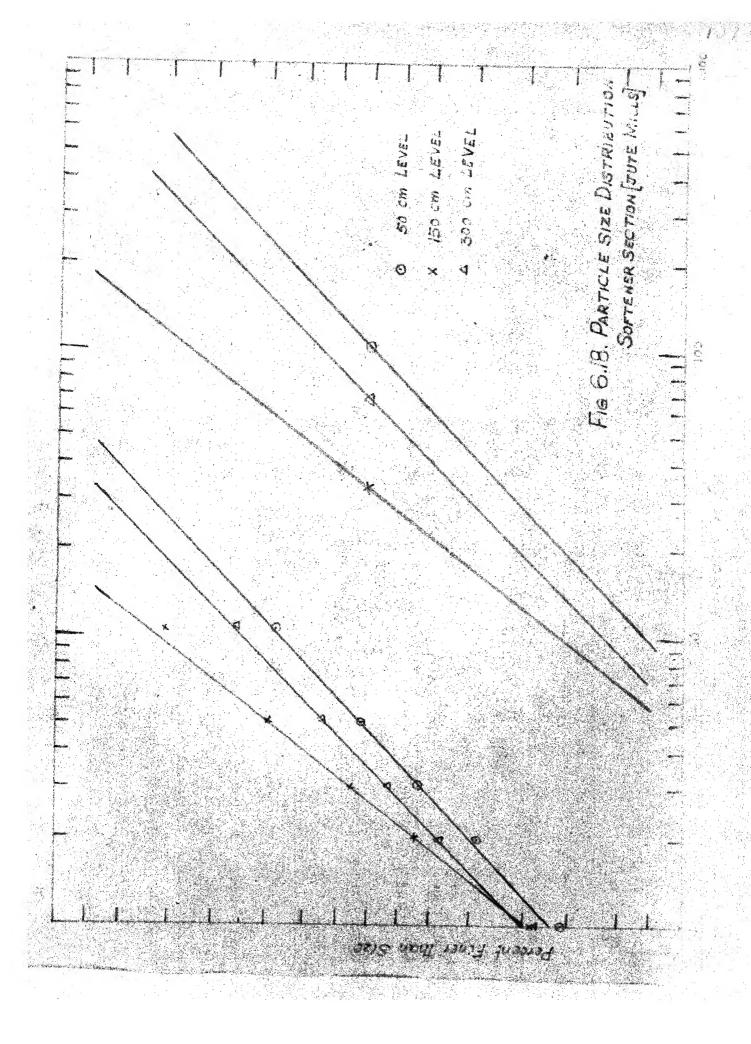

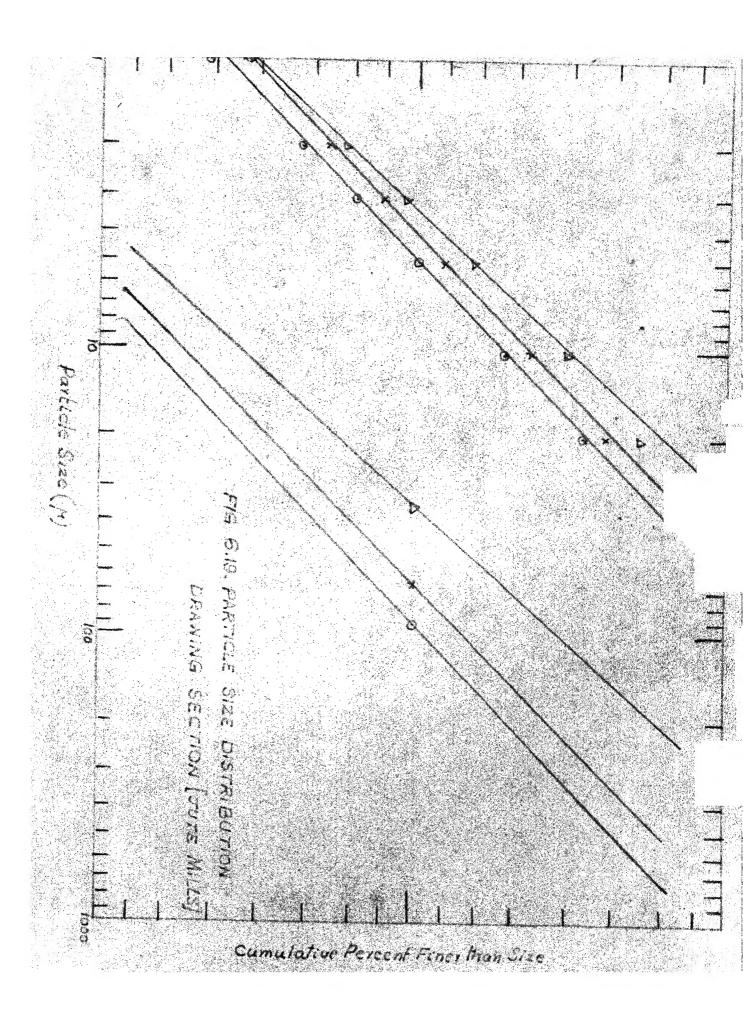

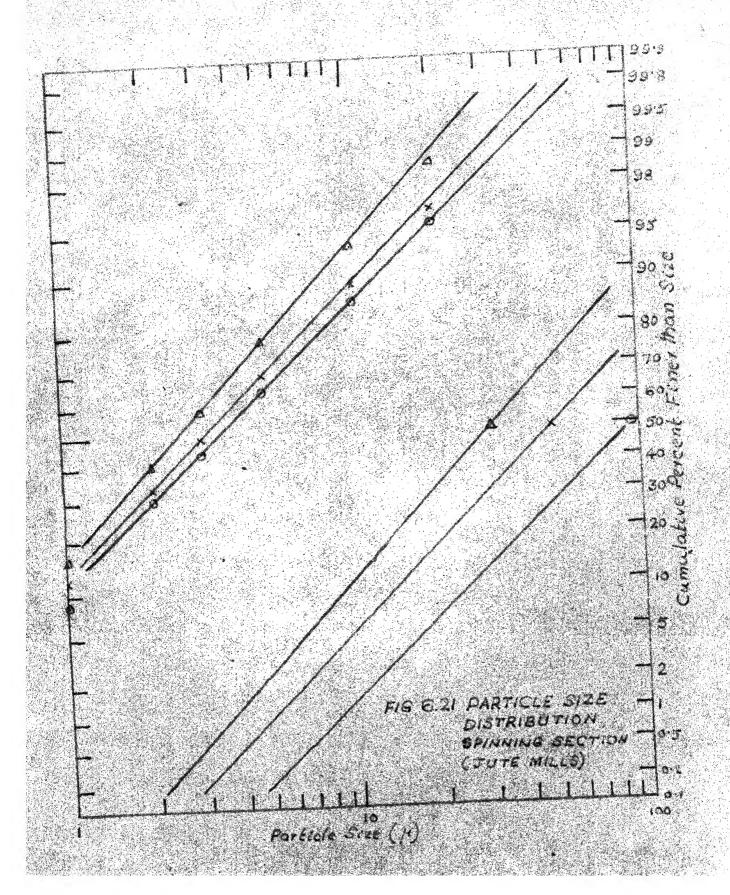

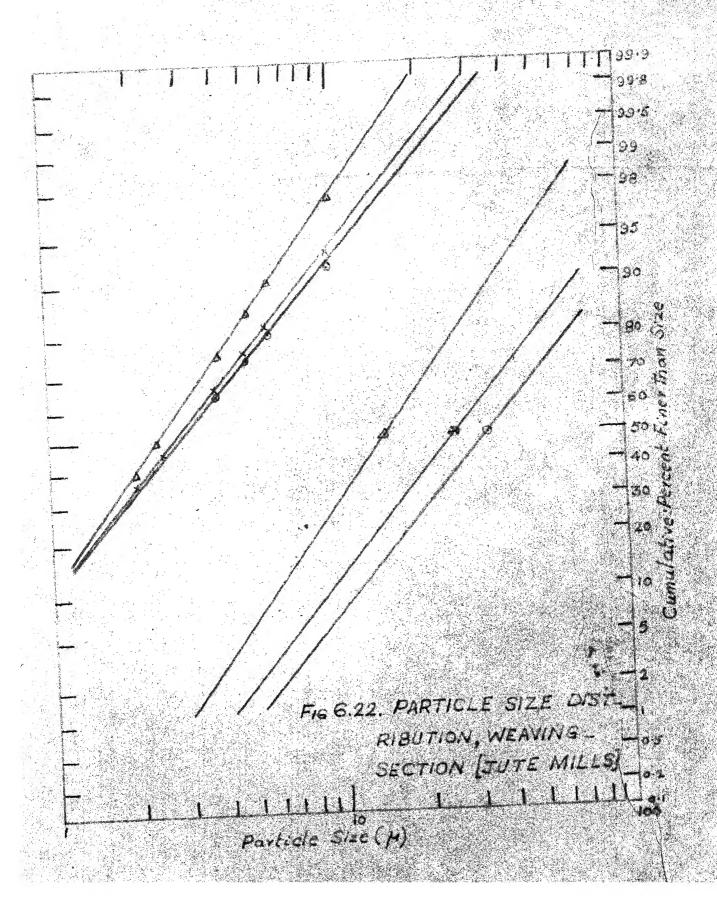


Table 6.12 Percent weights of particulate frections at different heights in various sections of the jute mill.

A TOTAL CONTRACTOR OF THE PROPERTY OF THE PROP	A CONTRACTOR	Ci-demont patrongs using	The state of the s		The state of the s						
Sections		Charles well processes to the second	***************************************	COMPANY DESCRIPTION OF THE PROPERTY OF THE PRO	Percent Welghts of	Welghts		Tractions of			Catalogue - A page 1
		V 2	5-10	77_20	02 10	7, 12		ı	T SARTO	P. Sendocher College (Sendocher Sendocher Send	
Q + + 0 % 0 %	1				64-70	77-40	47-20	51-75	76-100	>100	
NOT CELLET.	ぴ	7.0	ر ي	4.4	5.5	7.0	0.9	14.)	0 01		Mark of Park
	լ զ	0.4	2.2	8.4	0	c	• (-	O • O †	24.0	
	+	. () (0.	0.0	ာ အ	17.0	17.0	35.0	
	ပ	0	4	19.5	20.0	15.0	10.0	16.0	-	1 (
$\mathtt{Carding}$	ರ	0.2	1.2	5.1	7.0	6.5		\$ C	• •	0 *	
	Q	0.4	٢ (α		•	•	T+•)	15.0	47.0	
	!	•	1		O.O.T	0.0	0 ° 8	16.0	12.0	24.0	
	ပ	7.	5.9	18.0	17.0	13.0	10.0	7, 7,	<u> </u>	0 0	
Drought & C	Ó	c	r		,		•	· / ·	0	TO•CT	
DI GW LILE	び	7.0	T• T	5.2	6.5	7.0	6.9	(51	0	()	
	Ъ	7.0	0	C 15	0		•	· OH	0 • 1 1	d. / • 0	
	·	•) + +		74.0	77.0	0.6	17.)	0.6	0 /0	_
	ပ	2,57	٥. د.	26.0	18,5	0.21	c) i) +	
)	1	٠ ٧	12・7	6.5	9,5	_
Spinning	ದ	1.2	0.9	17.8	71.	((
	2,	L			; }	· • • • • • • • • • • • • • • • • • • •	0.07	T4.)	ろ ・ の	13.0	
	a	۲. ۲).• Q	ာ• aT	10.0	12.0	10.01	13.)	0.77	0	
	ပ	2.3	10.2	24.5	19.0	13.0	C C	, (• •	O• 14	
1					•	•	0.0	10.7	6.5	5.5	
Weaving	ಥ	1.1	6.4	19.5	18,0	13.0	10.0	16.0	u V	L	
	q	2.2	10.0	25.8	20.0	0.81	α) () () ·	U.V.	
	c	C		0		,	•	74.7	→	5,0	
		7.0	7.77	ງຜ ຸ ບ	18.C	7.0	4.0	3.)	6.7	0.4	
C	ب د د		2	l I				Parket of the Contract of the		•	

a for 50 cm, b for 150 cm and c for 300 cm height above floor level.

6.9.3 Effect of exhausts on vertical transport of particulates

Comparison of particulate concentrations at two stations in the carding section, one(B) with an exhaust fan on the roof and another (A) with no exhaust fan is given in Table 6.13. It also gives the size distribution of particulates in air at the two stations. The values were obtained from Figs. 6.23 and 6.18. The concentrations in all levels at the station B were found to be much less (one third to one sixth), than those at the station A. This is due to the continuous removal of particulates by the exhaust and settling on the floor. The percentages of finer fractions of sizes less than 20 \(\mu \) were found to be nore in the upper layers of the area were the exhaust was provided. The effect of exhaust was observed to be less on particulates of size range from 20 - 100 \(\mu \). The percent fractions above 100 \(\mu \) size showed a slight increase in this area.


There should have been a higher percentage of all fractions. But for sizes between 20 and 100 μ the area without exhaust showed higher values. The reasons for this is not fully known. It may be due to the difference in force patterns acting on the particulates of the two stations.


6.9.4 Effect of openings on horizontal transport of particulated

Fig. 6.24 gives the plot of $\log \frac{c_0}{c}$ vs L. It gives a set of straight lines indicating exponential relation. The

Comparison of size distribution of particulates in creas with and without exhaust fans. Table 6.13

					Percont	fract	Percent fractions by weight of	werght	of sizes	es (h)	
Section		concentration (ng/n3)	<.5	5-10	11–20	21=30	21 - 30 31-40 41-50	41-50	5r-75	C0T-9L	>100
Carding A(withou t	ದ ಭ	78.2	0 0	1,52	5.1 8.5	0.01	6.5	7.0	14.0	12,0	47.0
exhaust)	O	27.2	1.1	5.9	18.0	17.0	13.0	10.0	15.5	6 5	13.0
Carding R(with	ಥ	21.5	0.05	0	2.	3.5	5.0	5. 5.	13.0	11.0	58.0
oxhaust)	P	10.2	0.5	2	7.6	10.0	10.0	0.8	17.0	11.0	31.0
	ပ	10.0	3.0	3.5	18.5	14.0	11.0	O•8	14.0	0.8	15.0

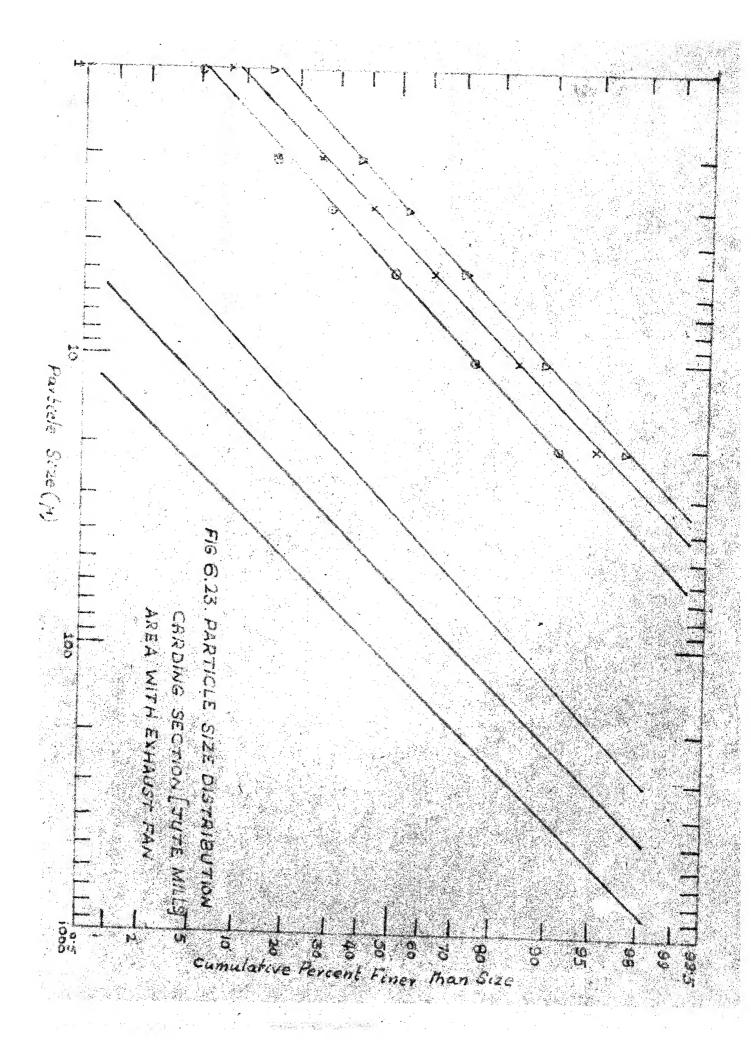

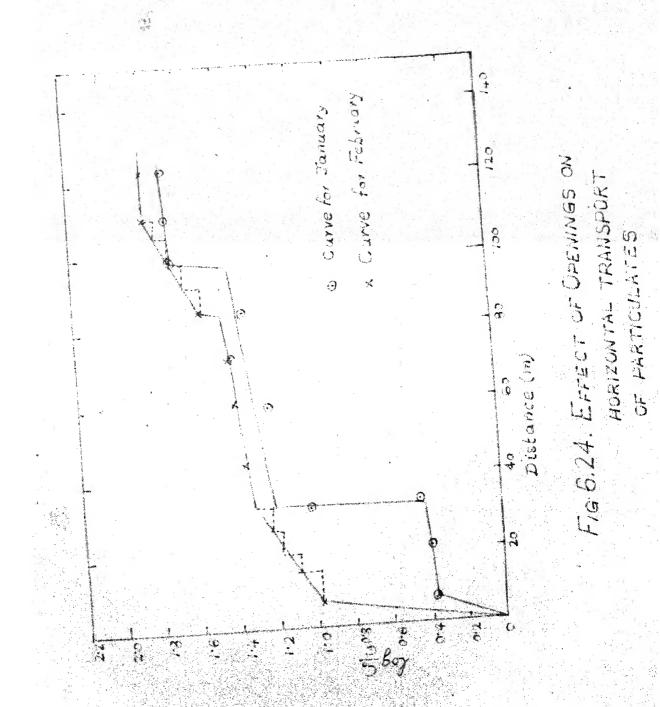

where doors are provided on the eastern side. The wind blowing in through these doors seems to affect the particulate transport in the room. The doors on the western side were found to have little effect on the particulate transport.

In the curve for February, instead of breaks, inclined lines with steeper slopes could be seen. These lines indicate the combined influence of a number of openings present on the eastern side. If more observations were made between the openings, a step-like pattern (one break for each opening) as shown in the figure by dotted lines would have been resulted.

The value of the coefficient λ , in the equation $\log \frac{C_0}{C} = \lambda L$ was determined for different stretches of the length and ranged from 5.07 x 10^{-4} cm⁻¹ to 9.3 x 10^{-6} cm⁻¹. for January. For the lengths with windows which were kept closed during January and opened during February, the values changed to 3.76×10^{-5} cm⁻¹ and 5.4×10^{-5} cm⁻¹ respectively indicating a reduction in the transport. The transport of particulates are, therefore, very much reduced by the cross draughts produced due to inflow of air through openings on windward side.


A similar plot of $\log \frac{C_0}{C}$ vs Z, the height, is given in Fig. 6.25. This represents the vertical transport of particulates in the seftener sections. The value of λ was found to be 1×10^{-4} cm⁻¹, indicating lower transport. The coefficient of eddy diffusion (D_t) in the vertical direction was determined from the equation, $\ln \frac{C}{C} = -\frac{v_s}{D_t}$ (Fuchs 1964). The value obtained, 20.9 cm²/sec, was very high compared to 0.01 to 0.02 cm²/sec for gases (Foust 1964). This indicates that the transport is due to elution rather than due to diffusion.


6.10 INFERENCES FROM ANALYSIS OF SETTLED PARTICULATES

The plot of cumulative percent by weight of size fractions against sleve openings on a log-probability paper gave special shaped curves as shown in Figs. 6.26 and 6.28. It is obvious that the sample contains dust and fibre and hence the two seperate shapes of plots. (In the previous plots such shapes are not seen because, there, the numbers of dust and fibres were separately determined and plotted).

C.10.1 <u>Difference in Resistance to vertical and horizontal</u> Transport of particulates

Figures 6.26 shows the cumulative percent plot of size fractions for two points at 2 m height above floor level, one just above the softener and the other at 5 m

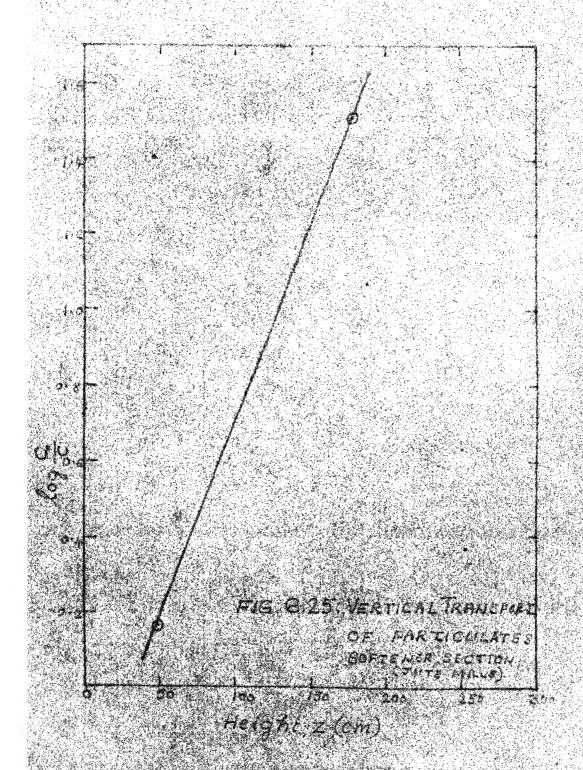

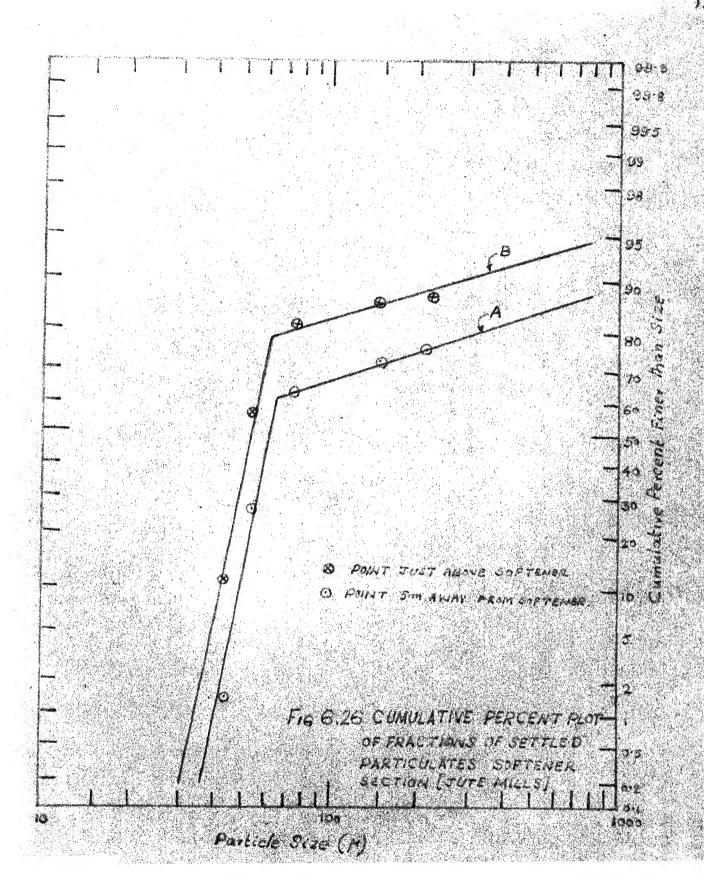

away from it. The cumulative percents of the dust and fibre fractions are given in Fig. 6.27. The details of analysis are presented in Table 6.14. The geometric mean sizes were found to decrease from station 1 to station 2 which should be expected because of the settling of larger fractions during transport. The standard deviation in both cases were observed to be 1.18 for dust. This shows that the sizes of settled particulates cone in a very narrow range and this is the maximum size of dust particles present in the total sample. Also, the room air velocity is capable of removing particulates of sizes smaller than this. The mean sizes of fibre fractions were found to be bigger at station 2 compared to station 1. This is quite reasonable from the point of view of the orientation of fibre particles during settling when they take a vertical position. The resistance to transport in the vertical directions will be lower than that in the horizontal directions for fibres. This phenomenon will be a useful guide in deciding the location of exhausts.

Fig. 6.28 and 6.29 show similar plots for samples collected from different heights in the carding section. The details of analysis are given in Table 6.15.

The results show that the mean sizes of settled particulates, generally, decreases with height. This should be


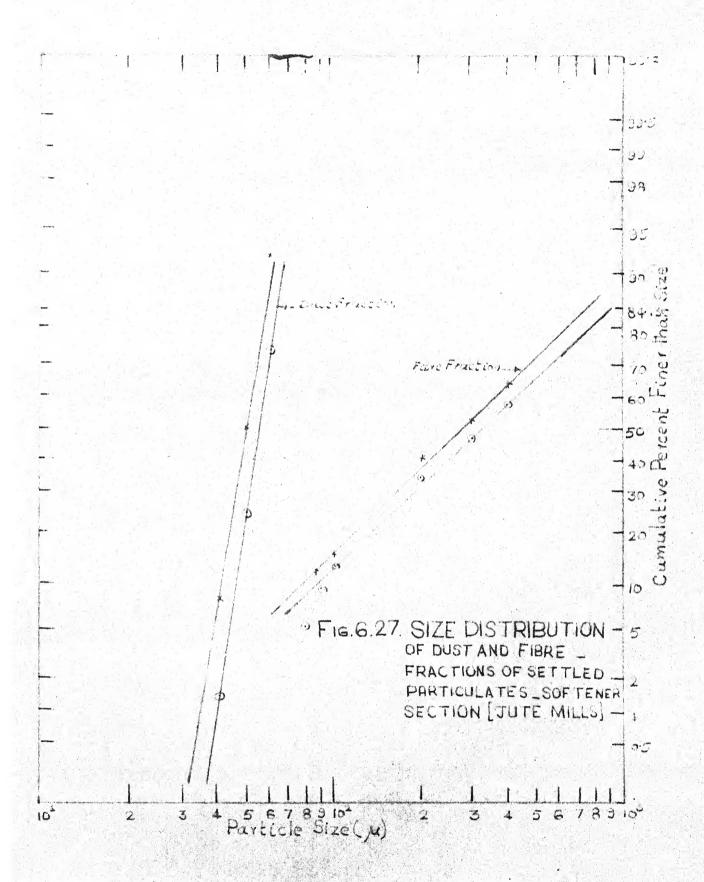


Table 6.14	Details above s	of analy oftenor s	Details of analysis of settled particulates collected from 2 n height above softenor soction. (Jute Mills)	tled parte Mill	ticulat s)	es collec	ted from 2	n height
Station	DUST Geonetric mean size (µ)	ic Std. ze dovn.	FIBEE Geometric noan size (µ)	Std. devn.	Percen < 30	t fraction	Percent fractions in total sample < 30 31-40 41-50 51-60	sample 51-60
Just above softener	56	1.18	220	2,81	0.15	6.57	33.3	34.0
5 m away from softener	50	1,18	275	2.73	0.01	6.0	14.1	31.0
	1	-			•		•••••••contd	
61-70 71-80		Fercent fr 81-90	Fercent fractions in total sarple 81-90 101-200	total san 101-200		201-300	>300	
	=1.0 1	٥٠٦	1.0	5.0		2.5	9.5	
16.0 2	2.0	1.5	1.5	0.8	0	5.0	20.0	

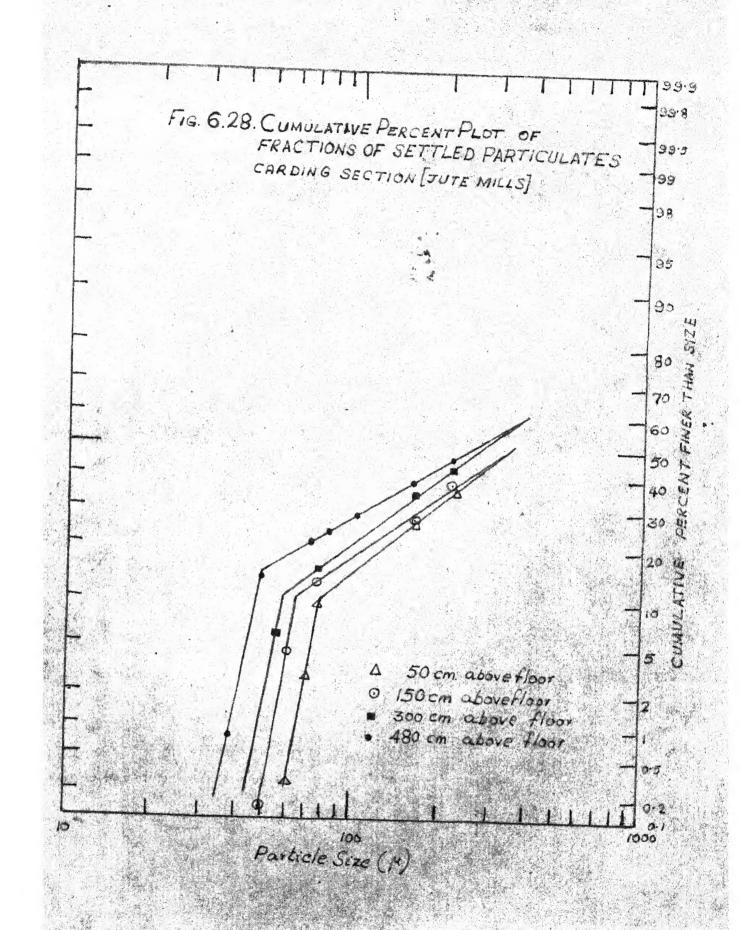

Andrew Control of the		125 1
Phonome and the second	FIG. 6.23 SIZE DISTRIBUTION OF DUST AND FIBRE FRACTIONS IN SETTLED FARTICULATES CANDING SECTION (STUTE MILLS)	— 93.5 — 93 — 98
The second of th		CUMULATIVE PERCENT FINER THAN SIZE
	A 50cm above floor a 150cm above floor 300 cm above floor 480 cm above floor	- 10 G
	Particle Size (N)	LLL or

Details of analysis of settled particulates at various heights in the carding section (Junte Mills) Table 6,15

			1 1	FIBRE		Per fr	actions	in total	1	
rosition	ц	a)		Geonetric	Std	<30	<30 31-40		51-60	I
		nean size		mean size	devı-					
		(ਜ)	ation	(n)	ation					
50 cm a	cm above floor		1.15	395		MIT	NTT	0.07	01-0	1
150 cm	- 4	62	1.15	405	2,69	NIL	NIT	0.15	4.27	
1000ci		47	1.17	330	•	0.02	1.78	13.20	7.00 K	
480 cn	-	2.1	1.18	345	•	NIL	0.04	1.76	90.00	
					•			contd.	,	
		7000	ŧ		ı	1	-		The second secon	
CH 13	00 10	Tercent	H	ᆌ	ธลา	Ф				
07-10	77-20	06-78	91-130	101-200		201-300	301-400	< 00	400	
L C	ر ر	2.0		19.0			10	C	ł (
-1 0	0 0 0 0		2.5	0.91	_	10.0	11.	. 0		
ر د د	N 1	•		16.0		•	7	0	k 1	
2.5	3.0	2.0	•	18.0			· C	0	38.0	
	The second secon		With the standard section of the section of		-		The second secon			

,,

the case because larger particulates are more in the lower layers as they settle easily. In the last stretch an increase in mean size was observed. This is due to the suction effect exerted by the exhaust fans provided in this section. The percent fractions in the total sample also show expected results. The percentages of finer fractions were found to be more at higher levels and those of bigger fractions at lower levels. The deviations from this general pattern are few and can be attributed to the location of source, difference in air velocity and the presence of exhausts on roof.

In general, the ventilation conditions in the factory room showed that natural ventilation could not be depended upon to reduce particulate pollution in the preparing sections of the factory room. The distribution of supply points are not satisfactory, especially in the softener section, Modifications in the present system will improve the ventilation and reduce particulate pollution considerably.

CHAPTER VII

PROPOSAL FOR AN IMPROVED VENTILATION SYSTEM FOR A TYPICAL FIBRE FACTORY

Any system of ventilation intended for reducing pollution should be capable of preventing unnecessary dispersion of contaminants. It should also keep the pollutant concentrations in occupied spaces within permissible limits. The results of the studies carried out have shed some light on the influencing factors, a knowledge of which is essential for the design of a desirable ventilation system. Of the three mills covered by this study, the jute mill seemed to have the most adverse conditions as regards particulate pollution and the discussion in previous chapters clearly reveals that pollutional hazards can be reduced to a minimal if not entirely eliminated by modifications and improvements in the ventilation system. Outlines of a proposal for such modifications are given below which are also expected to indicate directions for other mills.

7.1 EXISTING VENTILATION SYSTEM IN THE JUTE MILL

7.1.1 Details of the Factory Room:

Fig. 7.1 shows details of size, openings and exhausts of the factory room, the ventilation conditions of which were studied in detail. (Table 5.1 gives details

			Trong and a second a second and	SWLENT OF E. HWS OF POSE TOTAL EXM.S.		FIG. 74EALSTING VENT.LATT.
	4	i de la companya de l		in t	Ė	
		F			花装	
1				İ		
		Ė				
				The second secon		
		Ë		1		
4			** <u>*</u>			

like volume of the room, areas of openings, rate of air extraction, rate of air supply, etc of the room in question.)

7.1.2 Operation schedule:

The operations of exhausts, inlets, outlets and other openings during the year round are given in Table 7.2.

Table 7.1 Operation Schedule for Existing Ventulation System in the Jute Mill

; Unit	Period of Operation or of keeping open
Exhaust fans and local exhaust	Throughout the day on all working days
Supply inlets	From April through September depending on outside temperature
Doors on outlet side (West)	Throughout the year
Doors on sides (North and South)	Throughout the day on all working days, Partially covered during winter.
Doors on inlet side(East)	As above (Doors on sides)

7,1,3 Defects in the present system:

Even though exhausts are provided in the softener and carding sections, the particulate concentrations in these sections are above the permissible limit throughout the year. During summer months when cold air is supplied and

concentrations are least in other sections, the particulate concentration in the softener section is still high. These indicate that the ventilation is inadequate and inefficient. The following defects in the present system could be pointed out.

1) Location of local exhaust in the softener section:


The location of the local exhaust hood provided over the softening machine (Fig. 7.2), is not correct in relation to its position with the emulsion (oil-water mixture) supply point. At present, it is provided just after the emulsion supply point. When the moisture content of jute is high, particulate escape from it will be low. So the present location of the hood is at a point where the particulate production is least and is not commensurate with good efficiency.


2) Location of exhaust fans:

In the carding section exhaust fans are so located (Fig. 7.3) that the flow induced by them disperses the particulate produced by the breaker carding machines (major source) into the working environment. The flow pattern should be such that the dust bearing air stream should, as far as possible, not cross the breathing zone of workers.

3) Elevation of exhaust fans:

The capacities of the exhaust fans are low and their present elevations make them incapable of producing the

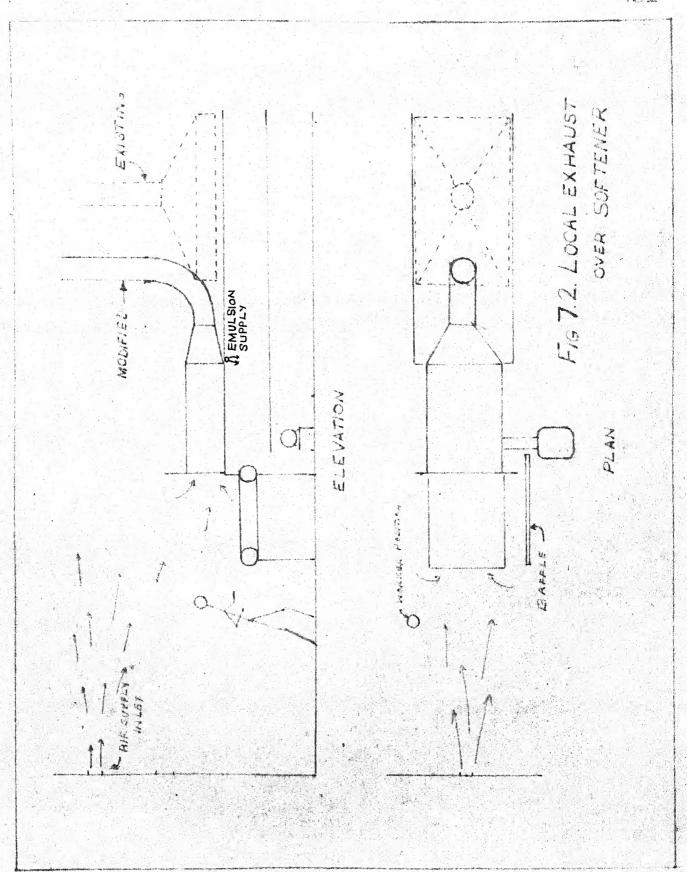

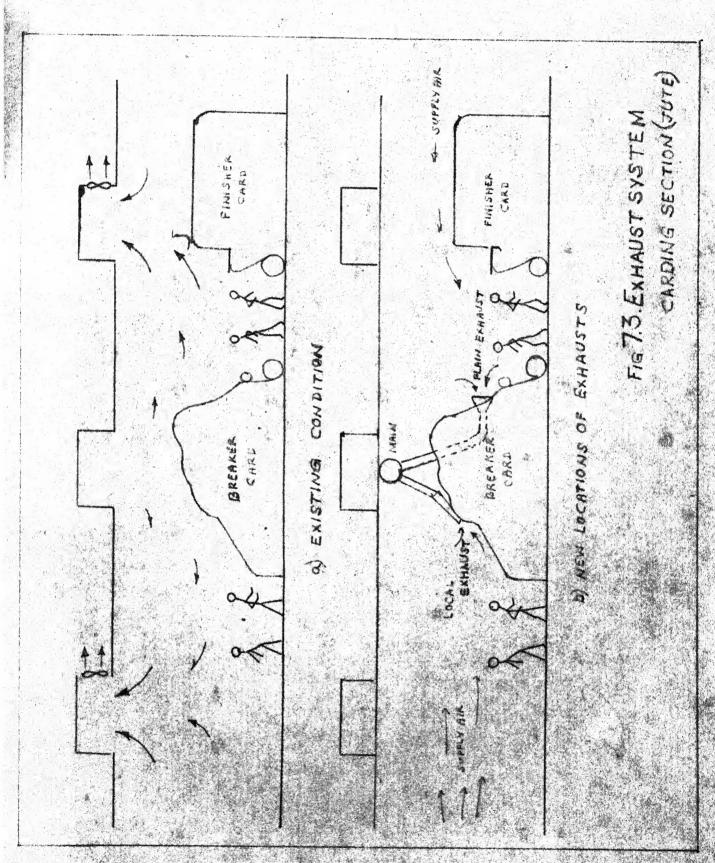

required capture velocities at the source. The induced relocities below the orderest fans are given in Table 7.3.

Table 7.3 Induced velocities below exhaust fans in carding sections (based on theoretical computations).

Distance X		V	elocity at	X below	fans	
(m)	F ₁ (4.88 m	3/sec.)	F ₂ (4.50 m ³	/sec.)	F ₃ (1.75 m	3/sec.)
	cm/sec.	fpn	cm/sec.	fpm	cm/sec.	fpn
0	97.5	191.0	90.0	176.5	35.0	68.5
(0.463)					(24.5)	(50.0)
1.0	32.5	63.7	30.0	58.8	11.6	22.8
(1.156)			(24.5)	(50.0)		
(1.22)	(24.5)	(50.7)				
2.0	10.7	21.0	10.0	19.6	3.9	7.6
3.0	5.1	10.0	4.7	9.1	1.8	3.6
4.0	2.9	5.8	2.7	5.3	1.1	2.1
5.0	1.9	3.7	1.8	3.4	0.7	1.3

^{*} Values inside parentheses show critical velocity and the distance from the exhaust fan where this velocity is induced.

A velocity of 50 fpm, required for capturing fine particulates, occurs, only very near the exhaust openings. The room air velocities measured at lower levels below the fan are higher than calculated values indicating that these are not induced by the exhaust fans. — Tentilation system intended

for reducing particulate pollution will be effective only if the velocities induced by the exhaust arrangements at the source are at least 25 percent more than the prevailing velocity there (Hemeon 1963).

4) Locations of air supply inlets:

Air supply points in the carding section are located at heights of about 2.65 m above the floor. The sources are located below this level and the exhausts above it. The effectiveness of the exhausts in mremoving particulates will be reduced by this arrangement.

5) Locations of doors, windows and other openings:

The location of the entrance door D₁ adversely affects the efficiency of the local exhaust over the softening machine. Air velocities near the hood caused by flow through the door ranged from 60 - 140 fpm compared to the face velocity of nearly 80 fpm of the hood. The cross draught produced by the air flow adversely affect the particulate capturing capacity of the exhaust hood.

The difference in height between the centres of inlets and outlets is only 70 cm. and the chimney effect produced by this height is very low. Utilization of natural ventilation, especially, in the less polluted sections will be less effective due to the low chimney effect.

7.1.4 Remedies:

The remedies for the various defects are presented below:

1) Better location of exhaust system in softener section :

The location and orientation of the exhaust hood should preferably be changed as shown in Fig. 7.2. The exhaust before hood should be located just setter the emulsion supply point. A cover over the length of softener in front of the hood, will prevent the escape of particulates and will effectively bring the hood face mearer to the worker. Air supply from behind the worker will give a push-pull effect for the total system and particulates escaping while feeding the jute to the machine also will be trapped by the air stream. The design of the modified local e-thaust system is given in Appendix - I.

2) Exhaust Arrangements in Carding Section:

To get a desirable flow pattern for preventing the dispersion of particulates into the working environment, the exhausts in this section should be located above the breaker carding machines. Appendix - I gives designs for various alternatives. Exhausts provided on the roof which will give a velocity of 0.245 m/sec (50 fpm) at the source will have a total extraction rate of 152.69 m³/sec., nine times that for local exhaust system. Lowering of the exhaust

openings upto 1.1 m by piping does not reduce the extraction rate. A system with local exhausts for the Breaker and finishing cards will have the least total extraction rate of 16.92 m3/sec., But the initial cost in this case will be maximum because of the pipings and enclosures needed. Also, this system will not take care of the particulates leaking out of the enclosures. A combination of local exhaust for the breaker carding machine and a plain exhaust opening for the area between the breaker and finisher cards has a flow rate of 26.93 m³/sec. The initial cost in this case will be considerably less because of less duct work. Also this will serve better the working area between the carding machines. Particulates leaking out of the enclosures also will be taken care of. The actual choice will have to be made on the basis of particulate removal efficiency and of overall economy. According to present analysis alternative 4 given in Appendix -I . seem to be more desirable in most cases.

3) Air supply in lets:

In the softener and carding sections, air supply in lets should be so located that a push-pull effect is attained. For this, the air supply points should be located along the transverse direction (east-west direction) and the flow should be at right angles to it. The existing air supply inlet in this section should be closed.

4) Locations of doors, windows and other openings:

In the softener and carding sections, as the ventulation is a forced one, openings other than inlets and outlets should be a minimum. The entrance door D_1 is very essential for the movement of men and materials. The same is the case with doors D_2 and D_5 . Doors D_3 , D_4 , D_6 and D_7 may be closed. To avoid cross draughts produced by air flow through D_1 , a baffle which protects the face of the local exhaust hood should be provided.

To increase the chimney effect, the sunlight openings in the drawing, spinning and weaving sections may be modified to serve the dual functions of admitting sunlight and carrying air inwards or outwards. For this, shutters should be provided on the eastern and western sides of these openings.

7.2 MODIFIED VENTILATION SYSTEM IN THE JUTE MILLS

Fig. 7.4 shows the modified ventilation system in the jute mills. Local exhausts are provided over the softener and breaker carding machines. The area between breaker and finisher cards is served by plain exhaust openings. A main running over the breaker cards carries the particulates collected from the section for treatment or discharge into the atmosphere.

NUMBERE PER POWS 4 4	OPE 2 16 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	LATERAL GRALLES 11 SUPPLY INLETS; 52 ED VENTILATION ONS [JUTE MILLS]
SYMBOL DESCRIPTION N. B, P. P. P. S. PRINGE DESCRIPTION N. B, S. D. P.	S) —	Par.
3:	S S S S S S S S S S S S S S S S S S S	

7.2.1 Operation schedule:

For the new ventilation system, the operation schedule is given in Table 7.3.

lable 7.3 Operation schedule for modified ventilation system
in the Jute Mills

Unit	Periods of operation or of keeping open
Local and other exhausts	Throughout the day on all work-ing days
Air supply inlets in the softener section (wall grilles)	Throughout the day on all work-ing days
Air supply inlets on the other side of carding section (La-teral outlet from supply main)	During summer and winter months when the windows will be kept closed
Air supply inlets serving other sections	During summer months
Windows in drawing, spinning and weaving sections (east)	During all periods when out- side climate permits their opening
Doors on eastern, northern and southern sides	Throughout the day on all work- ing days (Partially closed during winter months).
Doors on western side	Throughout the year
Shutters in sunlight openings	During all periods when outside climate permits the opening of windows on eastern side.

7.3 VENTILATION CONSIDERATIONS IN THE PLANNING AND DESIGN OF A NEW JUTE MILL

A desirable ventilation system would be one which is economical in the long run and at the same time serves the purpose effectively. Natural ventilation system is always the most economical one. But it is, usually, inadequate to reduce pollution conditions in an industry to permissible levels under all weather conditions. A mechanical ventilation system on which one has complete control will be a better choice for industrial ventilation from the point of industrial hygiene.

In the case of a jute nill the preparing sections are more polluted and a forced ventilation system should be chosen for these sections. From drawing sections onwards, the particulate production is very low and the ventilation system should be designed for the maximum worker comfort. Fig. 7.5 shows the outlines of a ventilation system for a jute mill suggested on the basis of these principles. The softener and carding sections are separated from other sections to ensure better control. The windows and ventilators are so placed that natural ventilation coull be made use of whenever possible. The orientation of the building also is planned to neet this purpose. The operation schedule for the new ventilation system is given in Table 7.4.

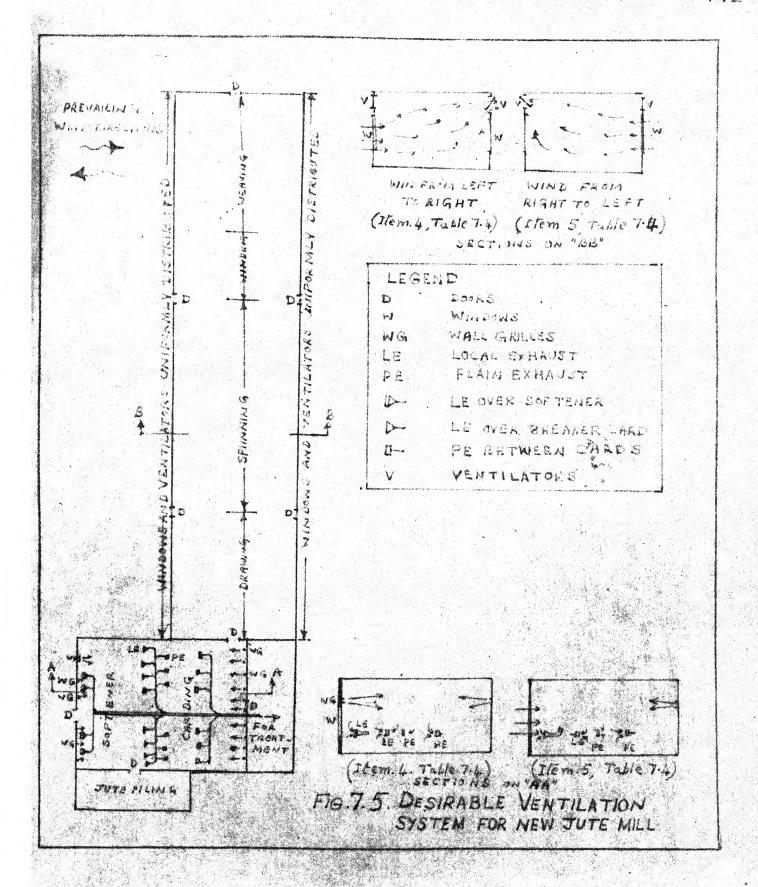


Table 7.4 Operation schedule for new ventilation systems in a Jute Mill

Unit	Period of operation
Local and other exhausts	Throughout the day on all working days
Air inlets on the left side as in Fig. 7.5.	During all the working hours when the windows on the left side could not be opened.
Air inlets on the right side as in Fig. 7.5.	Throughout the day on all working days irrespective of wind direction and temperature difference.
Windows on left side	Depending on the season. Opened when the wind is from left to right. When it is not possible to open the windows due to extreme temperature conditions they should be kept closed
Windows on right side	When the wind is from right to left. Closed when temperature outisde does not permit their opening. when
Ventilators on left side	Opened windows on right side are opened.
Ventilators on right side	Opened when the windows on left side are opened.
Air supply inlets in drawing, spinning and weaving sections	During summer months when cold air is to be supplied for worker confort. At this time all the windows and ventilators in this section are closed.

CHAPTER VIII

CONCLUSIONS AND SUGGESTIONS

8.1 <u>CONCLUSIONS</u>

From the limited studies carried out the following conclusions could be drawn:

- 1) Particulate pollution in the preparing sections of fibre factories are rather high and would pose health hazards to the workers.
- Natural ventilation is inadequate to reduce particulate pollution to the permissible levels in the highly polluted preparing sections of all fibre factories. In the case of jute mills a well planned natural ventilation system will be sufficient for sections following the drawing section and including that if they are separated from the preparing sections.
- particulate pollution to the permissible levels. Maximum efficiency of particulate removal could be expected only if flow patterns with adequate transport velocity are developed around the sources such that particulates will not disperse into the working environment but will be transported to the exhaust openings.

- 4) The transport of fibre particles in the horizontal direction is more difficult than that in the vertical direction. This indicates that the exhaust openings for the removal of fibre particulates should be so located that the flow induced, is in the vertical direction.
- 5) With a well designed ventilation system having proper locations of inlets and outlets and adequate exhaust flow rates, it is possible to reduce particulate pollution to permissible levels in all sections of fibre factories throughout the year.

8.2 ENGINEERING AND HYGIENIC IMPORTANCE OF THE PRESENT STUDY

The main difficulty in implementing industrial hygiene measures in India is the dearth for factual informations regarding pollution conditions in industries. On this score, the present study will be beneficial as it provides some useful data. Some of the significant factors are given below:

- 1) The rate of production of particulates by various machines and the size distribution of the particulates will provide useful data in planning control measures.
- 2) It is established that the effective removal of particulates is possible only by creating particular flow patterns having adequate velocity. This will serve as the basis of design for any ventilation system for reducing particulate pollution.

Informations regarding particle size distribution, weight fractions of particulates of sizes less than 10 microns, percentage of free silica and presence of microorganisms. If the particulates of factory room air are of hygiunic significance and may be made use of in the diagnosis and treatment of diseases among fibre factory workers.

8.3 SUGGESTIONS FOR FURTHER STUDIES

Let more work is needed to be carried out in the fibre factories for ascertaining pollution conditions, its effects on workers and its control. A few possible directions are mentioned below:

- and elaborate study with sampling and measurements during all the months of an year to give a more clear picture of the seasonal variations in pollution conditions and the influence of natural ventilation. A natural ventilation system designed on the basis of such complete data will be more effective in reducing pollution.
- 2) The effect of pollution on the health of workers be carried out in collaboration with medical profession.

- Detailed studies of particulate properties like hygroscopicity, dielectric constant, etc and their influence on the flocculation and transport of the particulates to help in designing better control measures.
- 4) Determination of velocity distribution inside the factory rooms under various conditions to help in deciding optimal modifications to the existing ventilation conditions and designing better ones. Computer aided-simulation model studies may be carried out for this purpose.
- 5) Model and pilot-plant studies as also in-plant studies, to verify the applicability of suggested improvements.
- temperature or relative humidity on the production and transport of particulates, we should be capable of keeping all other influencing factors constant and vary the interested phenomenon. But this was not possible because of the particular field conditions. So only the combined effect of influencing factors could be observed. A model study can solve such problems.
- 7) Ventilation studies could not be carried out in cotton and woollen mills and comparison was possible only on the basis of size-distribution of particulates.

REFERENCES

Allen, T., 1968, 'Particle size Measurement', Chapman and Hall Ltd., London, p.45.

Altshuler, B., et al, 1957, Aerosol deposition in Human Respiratory Tract', A.M.A. Arch., Indust. Health, 15: p. 293-303.

American Conference of Governmental Industrial Hygienists. 1964, 'Industrial Ventilation, 8th edn., p. 9 - 9 and p. 13-2.

American Conference of Governmental Industrial Hygienists. 1966, 'Air Sampling Instruments 1967', 3rd edn., Ohio, p. B-1-20 and p. B-3-38.

American Public Health Association, 1965, 'Standard Methods for the examination of water and waste water', 12th edn. p. 581, p.583 and p. 592.

American Society of Heating, Refregerating and Air Conditioning Engineers, Inc., 1966, 'Infiltration and Ventilation', Fundamentals and Equipment 1965 and 1966, p. 465.

Banford, W.D., 1955, 'Foundary Ventilation and Dust Control', Proceedings of The British Cast Iron Research Association, Harrogate, p. 65.

Brown, J.H., et al., 1960, 'Influence of Particulate matter in Human Lungs', Am. J. Public Health, 40: p. 450 - 459.

Caminita, B.H., et al., 1943, U.S. Public Health Reports, 58, p. 1165.

Camp, T.R., 1946, 'Sedimentation and Design', Trans. Am. Soc. Civil Engrs., $\underline{103}$, p. 897.

Dalla Valle, J.M., 1946, 'Exhaust Hoods', Industrial Press, New York.

Dean, T.J., et al., 1974, 'A New Approach to Factory Air-conditioning', Heating and Ventilation Engineer, 48: p. 45.

Drinker, P.S.B., and Hatch, T.B.S., 1954, 'Industrial Dust', McGraw-Hill Book Co., Inc., N.Y. P.45.

Durken, T.M., 1946, 'The determination of Free Silica in Industrial Dust', J. Indust. Hyg. Toxicology., 28: p. 217.

Fair, G.M., et al., 1968, 'Water and Waste Water Engineering', Vol. II, John Wiley and Sons, Inc., N.Y. p. 25-4 and p. 25-16.

Foust, A.S., et al., 'Principles of Unit Operations', John Wiley and Sons, Inc., N.Y., p. 171.

Fuchs, N.A., 1964, 'The Mechanics of Aerosols', MacMillan Co., N.Y., p. 259.

Hama, G.M., 1973, 'Jet Replaces Vertical duct in push-pull ventilation of pickling tanks', Heating piping and Air-conditioning, 47: p. 121.

Hamlin, L.E., 1944, Rocky Mt. Med. Jl., 41: p. 391.

Hatch and Choate, as reported by Drinker, P.S.B., and Hatch, T.B.S., 'Industrial Dust', Mc Graw-Hill Book Co., Inc., N.Y., p. 193.

Hewitt, P.J., 1973, 'Containment of Air-borne contaminants by Air flow', Heating and Ventilating Engineer, 47: p. 327.

Hemeon, W.C.L., 1963, 'Plant and Process Ventilation', The Industrial Press, N.Y. p. 27, p. 29 and p. 92.

Ingersoll A.C., et al., 1956, 'Fundamental concepts of Rectangular Settling Tanks, Trans. Am. Soc. Civil Engrs.. 121: p. 1179.

Kothari and Sons, 1972, 'Jute' Kothari's Economical and Industrial Guide of India 1972, p.1.

LaBelle, C.W., et al., 1955, 'Synergic effects of Aerosols', 'Particulates as Carriers of Toxic Vapours, A.M.A. Arch., Indust. Health, II: p. 297 - 304.

Mantell, C.L., ed., 1958, Engineering Materials Handbook, McGraw-Hill Co., N.Y., p. 30-43.

Meeky, S., et al., 1967, 'Byssinosis among winders in the Cotton Industry, British Journal Industrial Medicine, 24: p. 123.

Patty, F.A., 1958, 'Industrial Hygiene and Toxicology, Vol. I, Interscience Publishers, Inc., N.Y. p. 144.

Popa, V., et al., 1969, 'An investigation of allergy in Byssinosis, Br. J. Indust. Med. 26: p. 107.

Prausnitz, 1932, as quoted by Patty, F.A., 'Industrial Hygiene and Toxicolog,' Vol. II, 'Interscience Publishers, Inc., N.Y., p. 2254.

Publication division, 1974, 'India 1974', Ministry of Information and Broadcasting, Govt. of India, p. 233 and p. 269.

Randall, W.C., Conover, E.W., 1931, 'Pre-determining airation of Industrial buildings', ASHVE Transactions, 37: p. 605.

Report of Important Dust Explosion, 1957, National Fire Protection Association, Bosten.

Roach, S.A., Schilling, R.S.F., 1960, 'A clinical Environmental study of Byssinosis in the Lancashire Cotton Industry', Br. J. Indust. Med., 17: p.1.

Robertson, 1965, Hydrodynamics in Theory and Application, Printice Hall, Englewood, N.J., p. 393.

Sander, O.A., 1958, 'Pulmonary dust disease', Patty, F.A., ed., Industrial Hygiene and Toxicology, Vol. I, Interscience Publishers, N.Y., p. 357-411.

Schilling, R.S.F., 1971, 'Byssinosis', Encyclopedia of Occupational Health and Safety, Vol. I'. International Labour Office, Geneva, p. 230.

Schliching, H., 1958, Boundary Layer Theory', Mc Graw-Hill Book Company, N.Y.

Schlipkoter, H.W., 1971, 'Dust Biological Effect', Encyclopedia of Occupational health and safety, Vol. I, International Labour Office, Geneva p. 413 and p. 414.

Sham Lal, ed., 'Directory and Year Book', Times of India Press, Bombay, p. 86 and p. 163.

Silverman, Leslie, 1942, 'Velocity Characteristics of Narrow Exhaust Slots', J. Indust. Hyg. Toxicol, 24: p. p. 267.

Tuve, G.L., 1953, 'Air Velocities in Ventilating jets', ASHVE Transactions, 59: p. 261.

Witheridge, W.N., 1958, 'Ventilation', Patty, F.A., ed., Industrial Hygiene and Toxicology, Vol. I., Interscience Publishers, N.Y., p. 331.

Wright, T.J., et al., 1969, 'Viable microorganisms in an Urban Space', J. Air Pol, Con. Assocn. 19: p.337-341.

APPENDIX - I : Designs

1.1 Local exhaust over softener:

Data

Width of source

1.0 m

Distance of worker

from source

1.0 - 1.5 m

Transporting velocity

17.85 m/sec (3500 fpm)

(Witheridge 1958)

Design

Assume a velocity of 0.245 m/sec (50 fpm) at a distance of 1.0 m from the hood face. Let the face area of hood be 1.0 x 0.3 = 0.3 m².

Then rate of flow,

$$Q = 0.75 \text{ } \sqrt{(10 \text{ } \text{x}^2 + \Lambda)}$$

$$= 0.75 \text{ } \text{x} \text{ } 0.245 \text{ } (10 \text{ } \text{x} \text{ } 1^2 + 0.3)$$

$$= 1.892 \text{ } \text{m}^3/\text{sec.}$$

Face velocity
$$V_0 = \frac{1.892}{0.3} = 6.32 \text{ m/sec.}$$

= 1240 fpm.

Area of transporting pipe

$$\frac{1.892}{17.85} = 0.106 \text{ m}^2$$

Dia of pipe = 36.75 cm

Velocity distribution

X	V	
(m)	n/sec	fpm
0.5	0.865	170
1.0	0.245	50
1.5	0.1105	21
2.0	0.0623	12

1.2 Ceiling exhaust in carding:

Distance of source = 2.69 - 4.53 on feeding side

Distance of the

centre of breathing = 3.94 - 5.25 on receiving side

zone zone = 3.94 - 5.25 on receiving side

Let the velocity of flow at 4.53 m be 0.245 m/sec (50 fpm)

$$Q = 0.75 \text{ V} (10 \text{ X}^2 + A_f)$$

neglecting A_{f} ,

$$Q = 0.75 \times 0.245 \times 10 \times (4.53)^{2}$$
$$= 37.7 \text{ m}^{3}/\text{sec.}$$

$$\Lambda_{\rm f} = \frac{37.7}{20.4} = 2.11 \, {\rm m}^2$$

Section = $145 \times 145 \text{ cm}^2$

When the exhaust is lowered by 1.0 m.

Distance of source = 1.8 - 3.94 m from exhaust

Distance of breathing zone = 3.2 - 4.75 m on receiving sidc.

Rate of flow for plain exhaust is given by

$$Q = V(10 X^{2} + A_{f})$$

$$= 0.245 (10 X 3.99^{2})$$

$$= 41.7 m^{3}/sec.$$

Lowering the exhaust face does not reduce flow rate.

I-3 Local exhaust over carding machines (entry point)

Length of source = 2.0 m

Let the capture velocity at a distance of 50 cm from the exhaust be P 0.245 m/sec. (50 fpm)

The flow rate for a slot flanked by a surface is given by

Q = 2.8 LVX
= 2.8 x 2.0 x 0.245 x 0.5
= 0.68
$$n^3/sec$$
.

Face velocity = $0.68/2.0 \times 0.1$ (assuming slot face dimension as $2 \times 0.1 \text{ m}$)

= 3.4 m/sec (666 fpm).

Area of transporting pipe = $0.68/17.85 = 0.038 \text{ m}^2$ Choose 22 cm φ pipe.

Velocity distribution.

	A APPARATURA (A MATA A SERVICIO DE LA CALLA ARRANDA ARRANDA ARRANDA ARRANDA ARRANDA ARRANDA ARRANDA ARRANDA AR	V		
X = (m)	m/sec	fpm		
0.1	1.213	238		
0.2	0.607	118		
0.3	0.405	79		
0.4	0.304	60		
0.5	0.243	48		
1.0	0.121	24		

I-4 Local exhaust for carding for hopper below machine:

Pipe dia recommended = 9'' = 22.86 cm (area = 0.041 m³ (Alden 1948)

Static suction in inches of water = 0.75^{11}

Velocity of flow = 4005 Vo.75

= 3500 fpm

= 17.85 m/sec.

Rate of flow = 0.041×17.85

 $= 0.732 \text{ m}^3/\text{sec.}$

I-5 Local exhaust for finisher card (Alden 1948)

Pipe dia recommended = 6''

 $area = 0.01825 \text{ m}^2$

Velocity of flow =
$$4005 \text{ Vl}$$

$$=$$
 20.4 m/sec.

Rate of flow =
$$0.01825 \times 20.4$$

$$0.373 \text{ m}^3/\text{sec.}$$

I-6 Plain exhaust between carding machines:

Location 1.75 m above floor level. Let the velocity of flow at 1 m be 0.245 m/sec. (50 fpm)

$$Q = V(10 X^{2} + \Lambda_{f})$$

$$= 0.245(10 X 1^{2})$$

$$= 2.45 m^{3}/sec.$$

$$Arca = 0.18 \text{ m}^2$$

Face velocity =
$$\frac{2.45}{0.18}$$
 = 13.6 m/sec.

$$=$$
 (2665 fpm)

Area of transporting pupe =
$$\frac{2.45}{17.85} = 0.137 \text{ m}^2$$

Choose 41.8 cm \(\phi \) pipe.

Velocity distribution using formula $Q = V(10 X^2 + A_f)$

	V	
X(m)	m/sec.	fpm
0.5 1.0 1.5 2.0	0.95 0.24 0.11 0.06	186 48 20 12

I-7 Possible Combinations:

Item	System	Flow rate (13/sec)	Renarks
1.	Exhausts at ceiling 4 numbers	37.7 x 4 = 150.8	Piping and initial cost least. Recurring cost too much.
2.	Exhausts with opening lowered(4 numbers)	41.7 x 4 = 166.8	Short length of piping, initial cost low, Recurring cost high.
3.	Local exhausts syst- em for all machines	1.892x1=1.892 0.680x8=5.440 0.732x8=5.856 0.373 x 10 =3.730 Total 16.918	Initial cost maximum Maximum length of piping. Particulates leaking out is not removed.
4.	Local exhaust syst- em for softeners and entry points of bre- aker cards. Plain exhausts for area between carding machines.	1.89xl= 1.89 0.68x8= 5.44 2.45x8=19.60 Total 26.93	Initial cost medium length of piping medium. Particulates from the breathing zone are removed.

The actual choice will have to be made on the basis of particulate removal efficiency and of overall economy. According to the present analysis alternative 4 would seem to be more desirable in most cases.

I-8 Air supply inlets:

The design of air supply system for item No. 4 above is given below. From the measurement of the existing air distribution system the value of K in the equation

$$U_{cl} = \frac{K \sqrt{\Lambda_o U_o}}{X}$$

was found to be 1.77. This agrees with reported values of K for grilles. The design is done to give a centre-line velocity of 0.245 m/sec. (50 fpm) at a distance where the air stream reaches the workers.

$$X = 18.8 \text{ m}$$

 $U_{cl} = 0.245 \text{ m/sec.}$

Total discharge should be sufficient to make-up the air extracted.

Total discharge from the left side = 1.892 + 0.68 x 8 = $7.332 \text{ m}^3/\text{sec}$.

Let there be 4 inlets Discharge per inlet = 1.833 m³/sec. i.e., $\Lambda_0 U_0 = 1.833$, where Λ_0 is the face area of inlet.

$$U_{cl} = \frac{KV\Lambda_{o}U_{o}}{X}$$

Substituting for U_{cl} , \dot{K} , X and $\Lambda_{o}U_{o}$,

$$U_0 = 2.89 \text{ m/sec (566 fpm)}$$
 .
$$A_0 = \frac{1.833}{2.890} = 0.634 \text{ m}^2$$

Choosing an opening of 1.25 x 0.5 m with area 0.625 m², the face velocity = 2.93 m/sec (575 fpm)

Air supply from right side = $19.6 \text{ m}^3/\text{sec.}$

No. of inlets required
$$= \frac{19.6}{1.833} = 10.7$$

Provide 11 inlets of size 1.25 x 0.5 m with face velocity 575 fpm.

I-9 Duct system design :


The velocity pressure method outlined in the 'Duct Design Procedure' (American Conference of Governmental Industrial Hygienists 1964) was used for the duct-system design. The design includes the following steps:

- 1) Preparation of lay-out of the duct work.
- 2) Design of hoods
- 3) Determination of air flow rates for each exhaust hood.
- Assuming air velocities (3500 fpm) for each duct, determination nearest duct diameter. Choosing available diameter of pipe (ACGIH 1964, p. 6 1).

- 5) Determination of entrance loss for each hood using tables (ACGIH 1964, Fig. 6.5 p.6.14).
- 6) Determination of duct friction (ACGIH 1964, Fig. 6.16, p.6.26 and Fig. 6.20, p.6.32).
- 7) Balance pressure drop by adjusting duct size. For this the total pressure drop from any point in the system to each upstream opening was made same.
- 8) Summarization of system resistance.
- 9) Selection of appropriate and adequare fan. Steps
 8 and 9 were not done in the present design as the
 portion designed was only part of a bigger system,
 complete details of which were unknown.

I.9.1 Design of hoods:

Hood Name	Турэ	Area m ²	m ³ /sec.	
Local exhaust hood over sof- tener		0.30	1.892	
Local exhaust over breaker card	Slot	0.20	0.680	
Exhaust bet- ween carding machines	Plain	0.18	2.450	

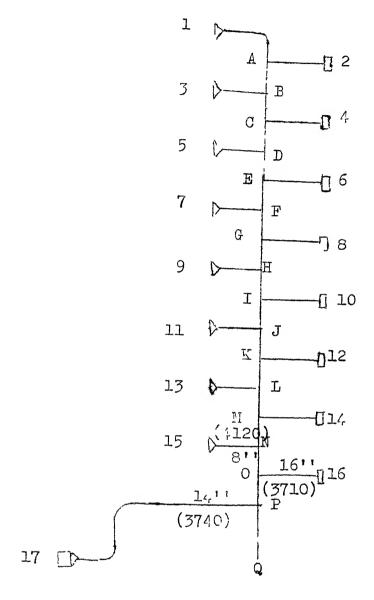

Local Exhaust over softener

Local exhaust over Breaker card

Plain Exhaust between carding machines

Fig. I-1 LAY-OUT OF DUCT WORK

I.9.2 <u>Duct System Design</u>

1.9.2	Duce by s	OCH DODIE				
Name	Straight Length (ft)	Elbows)(Noangle degree	Entries)(Noangle) degree	cfm	Duct dia. (inches)	Corrected dia (inches)
ALOBSCADSE6F7G8H9IJIKKLLMMN100PPQ	7.40 4.20 4.20 4.20 4.20 4.20 4.20 4.20 4	$1 - 90^{\circ}$ $2 - 90^{\circ}$ and	1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30° 1 - 30°	1440 5180 6620 1440 8060 5180 1440 14680 19860 1440 26480 26480 26480 27980 31440 34540 34540 41160 47780 5180 5180 5180 5180 5180 5180 5180 51	46 16 50 8 50 16 52	8 15 8 15 8 15 8 14.5 7.5 14.5 7.5 14.5 7.5 14.5 14.5

(२) लुप्तिविसर्ग, उपहतिवसर्ग तथा (३) त्रीडा, घृणा, त्रमंगल-व्यंजक तीन भाँति, विसंधि ये पाँच दोष संस्कृत ही में है।

४. इतळंद्स

रसविरुद्ध छंद, होय कै लक्ण-हीन 'सो इतकृत' द्वे भाँति है।

(१ रसविरुद्ध छंद्) यथा-

"वैनी उर्ल ट्ट परी कुच उप्पर चंपक-माल लगी लथ पिथय। कनक जँजीर सुंड गिह भुम्मत मनहु मत्त मनमध्यको हथ्थिय।।"

्यह श्रृङ्काररस-विरुद्ध छुंद है। भरतोक्त छुदोविभाग तें तत्तन्नायक रसोपयुक्त छुन्द जानिये।

(२ तत्त्रण-हीन छंद) यथा-

"हाथ तें चौसर छूटि परचो तहें 'ब्रह्म' भनै उपमा यह जोई। मनौ रस राह निकास लियो सिंस डारि दियो छिति में करि छोई॥"

्रहाँ भगगात्मक सबैया की चौथी तुक में एक लघु श्रिधिक है। यद्यपि लघु श्रन्यत्र होत हैं कहूँ, चौथे पद में नीको नाहिं लगतु। "आपने श्रानन-चंद की चाँदनी सों पहिले तन-ताप बुकायो।"

इहाँ यतिभंग है।

५. न्यूनपद्, यथा--

"कोकिल क्रकिन हूक चठै 'मुरलीघर' मोर मरूरिन मारी।" इहाँ "मोर-सोर सुनै मरूरिन मारी" इतनौ 'न्यूनपद' है।

६. श्रधिक पद, यथा—

"काम जित्यो जग कामिनी-नैनकमत तहि बान ॥"
इहाँ "कमल" श्रधिक पद है।